



MUA TURNED 180 DEGREES



KEF DISCHARGE CORRECTED



KEF



GAS LINES PAINTED



KITCHEN RTU ECON NOT FUNCTIONAL



KITCHEN RTU FILTERS DIRTY



DINING ECON NOT CLOSING FULLY

Set screw rusted. May be able to free with rust penetrant and re-set to fully closed position when unit off.



DINING RTU SUPPLY DROP

Leakage mostly resolved but some gaps are still present



DINING RTU SUPPLY DROP



DINING RTU DAMAGED WIRE



DINING RTU DAMAGED WIRE



KITCHEN HOOD & EQUIPMENT



EQUIPMENT SPACING FROM WALL



RESTROOM EXHAUST FANS DIRTY AND LOSING PERFORMANCE

Women's restroom seen here.



RESTROOM EF GRILLS DIRTY