

PlanGrid Task Report - Oct 9, 2024

Prepared by Will T

Oct 9, 2024

Description

17 tasks in this report.

Contents

#639 [SITE 010] [NEW] CRITICAL – Return visit required.	2
#637 [DUCT 006] [NEW] CRITICAL – Flex duct installation.	3
#636 [DUCT 007] [NEW] CRITICAL – Diffuser rigid 90's.	6
#633 Drive thru doors air curtain not operational	8
#632 [DUCT 016] Duct is restricted.....	10
#631 [DUCT 009] CRITICAL Dampers Incorrect type.....	11
#630 [Duct 501] Insulation Stick Pins.....	12
#629 [REFG 500] [NEW] WIF Temperature	13
#628 [DUCT 002] [NEW] CRITICAL – Turning vanes not in supply duct.	15
#627 [DUCT 011] [NEW] CRITICAL – Damper(s) bound.....	17
#625 [CNTL 508] [NEW] Controls labeling.....	20
#624 [EXHA 501] [NEW] Restroom fan is not secured.	21
#623 [EXHA 503] [NEW] Exhaust fan spare belt.....	22
#622 [EXHA 510] [NEW] Grease exhaust duct is not supported.	24
#621 [UNIT 501] [NEW] Equipment low voltage diagrams.....	25
#620 [UNIT 510] [NEW] Gas inlet grommet.	27
#617 [UNIT 999] [NEW] (MISC) AC Alarms	29

#639 [SITE 010] [NEW] CRITICAL – Return visit required.

Status

Open

Start Date

Oct 3, 2024

Type

Planned Work

Created

Oct 9, 2024 12:17 PM
will@nationaltab.com

List

TAB Punch List

Last Updated

Oct 9, 2024 12:17 PM

Description

Due to the CRITICAL tasks, a return TAB visit is required. Once all Tasks are completed and correction photos imported to PG, reach out to the TAB Supervisor for confirmation and scheduling the revisit. Contact the TAB Supervisor if a TAB report is needed for CO or for further diagnostics.

#637 [DUCT 006] [NEW] CRITICAL – Flex duct installation.

Status

Open

Start Date

Oct 3, 2024

Type

Planned Work

Created

Oct 3, 2024 6:14 PM
dylanc@nationaltab.com

List

TAB Punch List


Last Updated

Oct 9, 2024 12:00 PM


Description

Ensure flex inner core is taped and banded, along with tape or banding on outer insulation jacket. Flex is to be ran in lengths no greater than 4'0" in horizontal positions only.

Photos

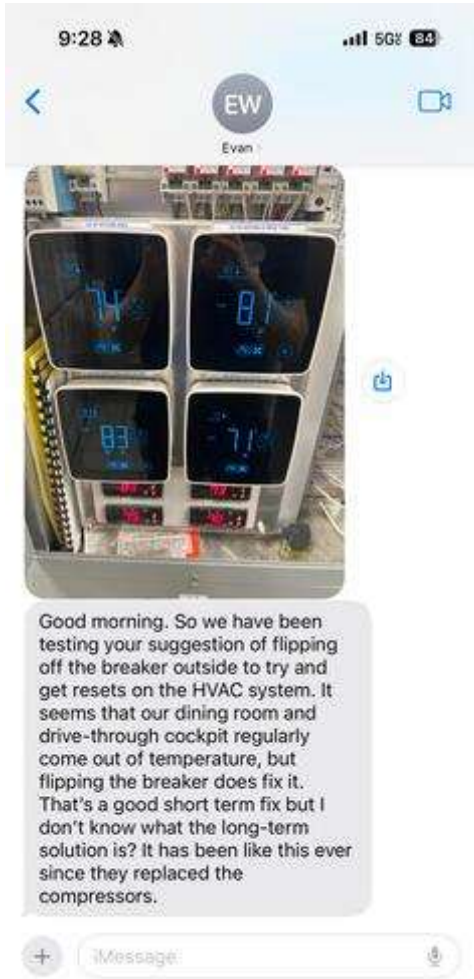

IMG_3928
Anthony Snyder
Oct 7, 2024 3:05 PM

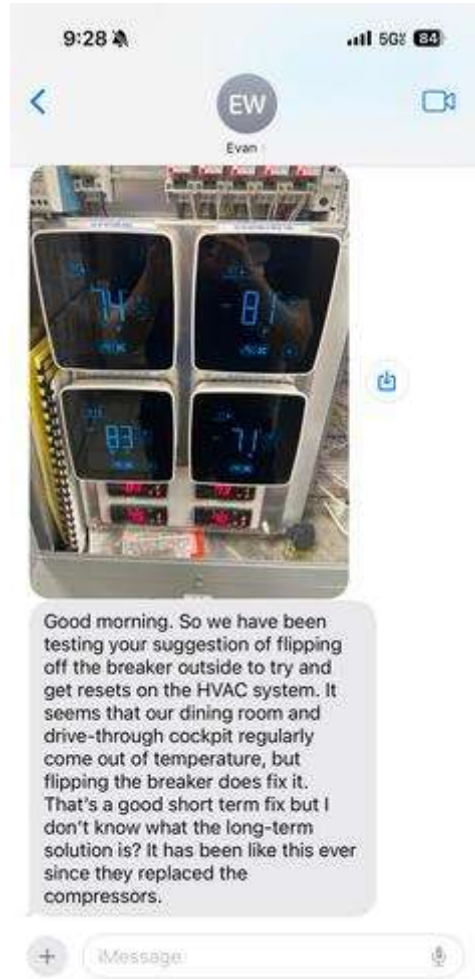

IMG_3928
Anthony Snyder
Oct 7, 2024 3:04 PM



image
Anthony Snyder
Oct 7, 2024 3:03 PM



IMG_3930
Anthony Snyder
Oct 7, 2024 1:54 PM

#636 [DUCT 007] [NEW] CRITICAL – Diffuser rigid 90's.

Status

Open

Start Date

Oct 3, 2024

Type

Planned Work

Created

Oct 3, 2024 6:14 PM
dylanc@nationaltab.com

List

TAB Punch List

Last Updated

Oct 3, 2024 6:16 PM

Description

Ensure rigid 90 degree fittings are secured to diffusers, with hard pipe risers adjusted to meet take off height elevation and connected to horizontal flex. No flex in drops allowed per details.

Photos



IMG_5820
Dylan Crisman
Oct 3, 2024 6:16 PM

#633 Drive thru doors air curtain not operational

Status
Pending

Start Date
Oct 3, 2024

Type
Planned Work

Created
Oct 3, 2024 1:38 PM
dylanc@nationaltab.com

Description
The drive thru door air curtain is not wired, and missing switches.

Last Updated
Oct 3, 2024 4:27 PM

Photos



20241003_162714_video

Anthony Snyder

Oct 3, 2024 4:27 PM

[Download video](#)



IMG_5814

Dylan Crisman

Oct 3, 2024 1:58 PM



IMG_5812
Dylan Crisman
Oct 3, 2024 1:58 PM

#632 [DUCT 016] Duct is restricted

Status

Open

Created

Oct 2, 2024 6:32 PM
dylanc@nationaltab.com

Type

Planned Work

Last Updated

Oct 2, 2024 6:35 PM

Description

Duct 3-11 just outside of play place flex duct is restricted due to tight 90 degree turns in flex duct, unable to push air flow to bring diffuser up to design total flow.

Photos



IMG_5818
Dylan Crisman
Oct 2, 2024 6:35 PM



IMG_5816
Dylan Crisman
Oct 2, 2024 6:35 PM

#631 [DUCT 009] CRITICAL Dampers Incorrect type.

Status

Open

Start Date

Oct 2, 2024

Type

Planned Work

Created

Oct 2, 2024 6:27 PM
dylanc@nationaltab.com

Description

4 diffusers in dining room
3-18,3-17,3-16,3-14. Have
the wrong dampers installed.

Last Updated

Oct 2, 2024 6:32 PM

Photos



IMG_1630
Dylan Crisman
Oct 2, 2024 6:32 PM



IMG_1633
Dylan Crisman
Oct 2, 2024 6:32 PM

#630 [Duct 501] Insulation Stick Pins

Status

Open

Created

Oct 2, 2024 6:27 PM
dylanc@nationaltab.com

Type

Planned Work

Last Updated

Oct 2, 2024 6:39 PM

Description

External insulation on bottom of ducts 24" or wider is to be supported by stick pins 18" on center. Cut pins and apply tape or mastic over stick pin washers.

No stick pins are visible on 24" ducts aforementioned.

#629 [REFG 500] [NEW] WIF Temperature

Status

Pending

Start Date

Oct 2, 2024

Type

Planned Work

Created

Oct 2, 2024 11:14 AM
dylanc@nationaltab.com

Description

WIF temperature holding at -6F. Should be holding at 0 degrees.

Last Updated

Oct 7, 2024 1:33 PM

Comments

This is a National Vendor issue.

Anthony Snyder Oct 7, 2024

Photos



IMG_5809
Dylan Crisman
Oct 2, 2024 11:16 AM

#628 [DUCT 002] [NEW] CRITICAL – Turning vanes not in supply duct.

Status
Pending

Start Date
Oct 2, 2024

Type
Planned Work

Created
Oct 2, 2024 11:08 AM
dylanc@nationaltab.com

List
TAB Punch List

Last Updated
Oct 8, 2024 11:48 AM

Description
AC-2 Turning vanes are not present in the supply duct and need to be added per specification.

Comments

Checked and confirmed that the turning vanes are in fact in place.

Mark Carlson Oct 8, 2024

Photos



IMG_5776
Dylan Crisman
Oct 2, 2024 11:09 AM

#627 [DUCT 011] [NEW] CRITICAL – Damper(s) bound.

Status

Open

Start Date

Oct 2, 2024

Type

Planned Work

Created

Oct 2, 2024 11:08 AM
dylanc@nationaltab.com

List

TAB Punch List

Last Updated

Oct 2, 2024 11:10 AM

Description

AC-1 Return Damper(s)
bound from restriction or
bound at start collar
connection, unable to
balance system until
corrected.

Photos



IMG_5805
Dylan Crisman
Oct 2, 2024 11:10 AM



IMG_5806
Dylan Crisman
Oct 2, 2024 11:10 AM



IMG_5807
Dylan Crisman
Oct 2, 2024 11:10 AM

#625 [CNTL 508] [NEW] Controls labeling.

Status

Open

Start Date

Oct 2, 2024

Type

Planned Work

Created

Oct 2, 2024 11:08 AM
dylanc@nationaltab.com

List

TAB Punch List

Last Updated

Oct 9, 2024 12:07 PM

Description

Sensor in play place does not have labeling present.

Photos

IMG_5787

Dylan Crisman

Oct 2, 2024 11:10 AM

#624 [EXHA 501] [NEW] Restroom fan is not secured.

Status

Open

Start Date

Oct 2, 2024

Type

Planned Work

Created

Oct 2, 2024 11:08 AM
dylanc@nationaltab.com

List

TAB Punch List

Last Updated

Oct 2, 2024 11:11 AM

Description

Restroom fan is to be secured with screws at all corners of curb.

Photos



IMG_5772
Dylan Crisman
Oct 2, 2024 11:11 AM



IMG_5773
Dylan Crisman
Oct 2, 2024 11:11 AM

#623 [EXHA 503] [NEW] Exhaust fan spare belt.

Status
Pending

Start Date
Oct 2, 2024

Type
Planned Work

Created
Oct 2, 2024 11:08 AM
dylanc@nationaltab.com

List
TAB Punch List

Last Updated
Oct 4, 2024 11:29 AM

Description
Exhaust fan does not have factory provided spare belt. Fan Sheave was Misaligned upon arrival ruined belt that

was attached, Had to use
spare belt once pulleys were
aligned. Will need a new one
left in motor housing for
Spare/replacement. (BX40)
Belt.

#622 [EXHA 510] [NEW] Grease exhaust duct is not supported.

Status

Open

Start Date

Oct 2, 2024

Type

Planned Work

Created

Oct 2, 2024 11:08 AM
dylanc@nationaltab.com

List

TAB Punch List

Last Updated

Oct 2, 2024 6:37 PM

Description

Exhaust duct is to be supported per kitchen hood exhaust fan detail on 6'0" centers.

Grease duct stands are wrong manufacturer per plan. Will also need more support for ducts as per plan states for every 6' or more a stand needs to be placed.

Photos



IMG_5766
Dylan Crisman
Oct 2, 2024 11:11 AM



IMG_5782
Dylan Crisman
Oct 2, 2024 11:11 AM

#621 [UNIT 501] [NEW] Equipment low voltage diagrams

Status

Open

Start Date

Oct 2, 2024

Type

Planned Work

Created

Oct 2, 2024 11:08 AM
dylanc@nationaltab.com

List

TAB Punch List


Last Updated

Oct 2, 2024 11:12 AM

Description

AC-1,AC-2,AC-3 missing laminated copy of controls detail low voltage wiring diagrams.

Photos

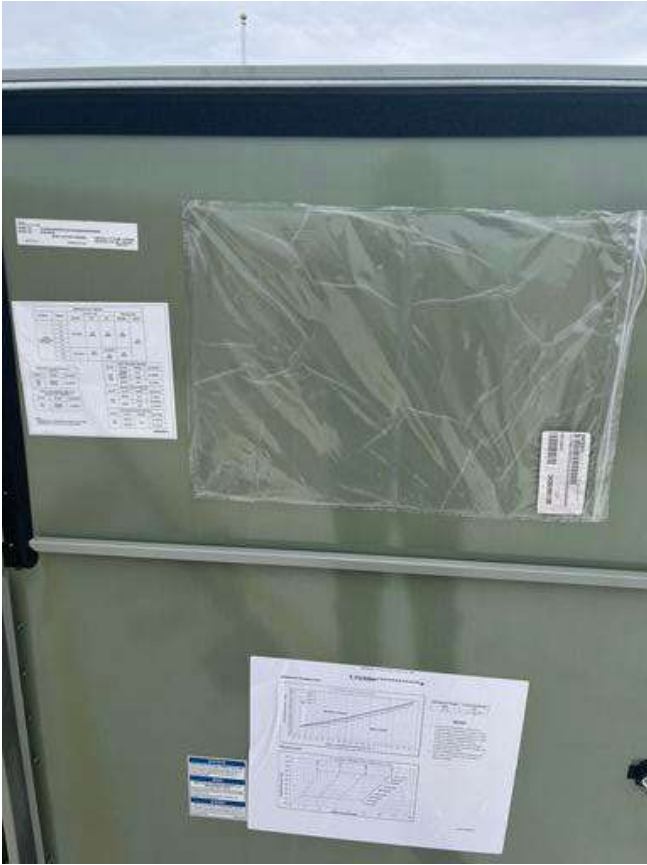

IMG_5750
Dylan Crisman
Oct 2, 2024 11:12 AM

#620 [UNIT 510] [NEW] Gas inlet grommet.

Status

Open

Start Date

Oct 2, 2024

Type

Planned Work

Created

Oct 2, 2024 11:08 AM
dylanc@nationaltab.com

List

TAB Punch List

Last Updated

Oct 2, 2024 11:12 AM

Description

AC gas inlet grommet is missing at the gas line/RTU penetration point.

Photos



IMG_5786
Dylan Crisman
Oct 2, 2024 11:12 AM

#617 [UNIT 999] [NEW] (MISC) AC Alarms

Status

Pending

Start Date

Oct 2, 2024

Type

Planned Work

Created

Oct 2, 2024 11:08 AM
dylanc@nationaltab.com

List

TAB Punch List

Last Updated

Oct 7, 2024 1:26 PM

Description


All AC units have alarms showing 1. "Space humidity active" 2. Space humidity input.

Comments

This is a Trane issue and they are scheduled to come back and fix this week.

Anthony Snyder Oct 7, 2024

Photos

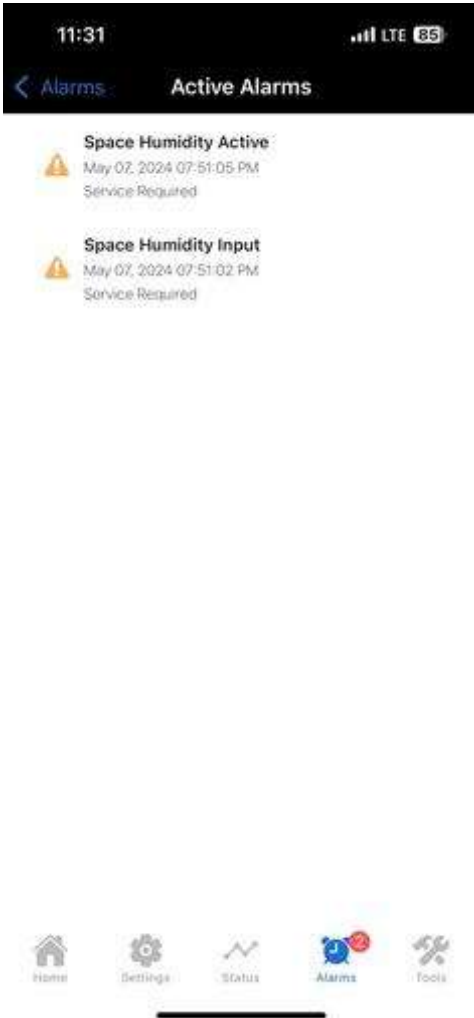

IMG_5743
Dylan Crisman
Oct 2, 2024 11:13 AM
