

# 636 TAB PUNCH LIST

Prepared by Ben Searles

Jul 25, 2025

## Description

15 tasks in this report.

## Contents

#273 [UNIT 016] [EXIST] Equipment curb adapters. ....	2
#272 [EXHA 500] [EXIST] Restroom rectangular duct riser. ....	4
#271 [UNIT 512] [EXIST] Equipment hail guards. ....	5
#270 [DUCT 508] [EXIST] Ductwork is not fully insulated.....	6
#269 [CNTL 512] [NEW] SEC Line voltage cover. ....	7
#268 [UNIT 517] [NEW] Condensate piping construction. ....	8
#267 [UNIT 999] [NEW] (MISC) AC4 grommet missing. ....	10
#266 [UNIT 999] [NEW] (MISC) AC2 water buildup. ....	12
#265 [REFG 504] [NEW] WIC/WIF door heater. ....	13
#264 [REFG 505] [NEW] WIC door sweep vs threshold. ....	14
#263 [REFG 506] [NEW] WIF door sweep vs threshold. ....	14
#262 [REFG 510] [NEW] WIC/WIF Heated pressure relief vents. ....	15
#261 [REFG 511] [NEW] PVC pipe chase (gooseneck) installation.....	16
#260 [REFG 516] [NEW] Condenser electrical disconnects. ....	17
#259 [REFG 999] [NEW] (MISC) WIF/WIC not operational. ....	18

## #273 [UNIT 016] [EXIST] Equipment curb adapters.

**Status**

Open

**Start Date**

Jul 25, 2025

**Type**

Planned Work

**Created**

Jul 25, 2025 12:22 PM  
bens@nationaltab.com

**Description**

AC1 and AC3 both have high static pressures due to the restrictions from the curb adapters. Both units are within design airflow.

**Last Updated**

Jul 25, 2025 12:26 PM

**Photos**



IMG\_2042  
**Ben Searles**  
Jul 25, 2025 12:26 PM



IMG\_2041  
**Ben Searles**  
Jul 25, 2025 12:26 PM



IMG\_2037

**Ben Searles**

Jul 25, 2025 12:26 PM

## #272 [EXHA 500] [EXIST] Restroom rectangular duct riser.

**Status**

Open

**Start Date**

Jul 25, 2025

**Type**

Planned Work

**Created**

Jul 25, 2025 12:22 PM  
bens@nationaltab.com

**Description**

Restroom exhaust's rectangular duct riser is missing the backdraft damper.

**Last Updated**

Jul 25, 2025 12:26 PM

**Photos**



IMG\_2049

Ben Searles

Jul 25, 2025 12:26 PM

## #271 [UNIT 512] [EXIST] Equipment hail guards.

**Status**

Open

**Start Date**

Jul 25, 2025

**Type**

Planned Work

**Created**

Jul 25, 2025 12:22 PM  
bens@nationaltab.com

**Description**

AC1's hail guards are missing.

**Last Updated**

Jul 25, 2025 12:26 PM

**Photos**



IMG\_1988

**Ben Searles**

Jul 25, 2025 12:26 PM

## #270 [DUCT 508] [EXIST] Ductwork is not fully insulated.

**Status**

Open

**Start Date**

Jul 25, 2025

**Type**

Planned Work

**Created**

Jul 25, 2025 12:22 PM  
bens@nationaltab.com

**Description**

Ductwork has exposed metal ductwork in some areas needs to be fully wrapped.

**Last Updated**

Jul 25, 2025 12:26 PM

**Photos**



IMG\_2004

**Ben Searles**

Jul 25, 2025 12:26 PM

## #269 [CNTL 512] [NEW] SEC Line voltage cover.

<b>Status</b>	<b>Start Date</b>
Open	Jul 25, 2025
<b>Type</b>	<b>Created</b>
Planned Work	Jul 25, 2025 12:22 PM bens@nationaltab.com
<b>Description</b>	<b>Last Updated</b>
Line voltage cover in SEC low voltage panel is missing and needs to be installed (EC).	Jul 25, 2025 12:26 PM

### Photos



IMG\_1994

Ben Searles

Jul 25, 2025 12:26 PM

**#268 [UNIT 517] [NEW] Condensate piping construction.**

**Status**

Open

**Start Date**

Jul 25, 2025

**Type**

Planned Work

**Created**

Jul 25, 2025 12:22 PM  
bens@nationaltab.com

**Description**

Equipment condensate piping or p-trap is not constructed per normal CFA specifications. There should be no reduction in size until after the second union to the unit.

**Last Updated**

Jul 25, 2025 12:26 PM

**Photos**



IMG\_1992

**Ben Searles**

Jul 25, 2025 12:26 PM

**#267 [UNIT 999] [NEW] (MISC) AC4 grommet missing.**

**Status**

Open

**Start Date**

Jul 25, 2025

**Type**

Planned Work

**Created**

Jul 25, 2025 12:22 PM  
bens@nationaltab.com

**Description**

There is a penetration on the outside of the panel door with a wire leading to what appears to be a sensor. This hole is not sealed properly and will allow water to enter the unit.

**Last Updated**

Jul 25, 2025 12:27 PM

**Photos**



IMG\_2001

**Ben Searles**

Jul 25, 2025 12:27 PM

**#266 [UNIT 999] [NEW] (MISC) AC2 water buildup.**

**Status**

Open

**Start Date**

Jul 25, 2025

**Type**

Planned Work

**Created**

Jul 25, 2025 12:22 PM  
bens@nationaltab.com

**Description**

There is a buildup of water on the lower portion in the blower door. This is believed to be due to the restrictions from the condensate line, but it is recommended to re-inspect the inside of the door to ensure the issue has been solved when the drain is changed.

**Last Updated**

Jul 25, 2025 12:27 PM

**Photos**



IMG\_2039  
Ben Searles  
Jul 25, 2025 12:27 PM

---

### #265 [REFG 504] [NEW] WIC/WIF door heater.

<b>Status</b>	<b>Start Date</b>
Open	Jul 25, 2025
<b>Type</b>	<b>Created</b>
Planned Work	Jul 25, 2025 12:22 PM bens@nationaltab.com
<b>Description</b>	<b>Last Updated</b>
WIC/WIF inner door heat strips are not working properly at time of inspection.	Jul 25, 2025 12:22 PM

---

**#264 [REFG 505] [NEW] WIC door sweep vs threshold.**

<b>Status</b>	<b>Start Date</b>
Open	Jul 25, 2025
<b>Type</b>	<b>Created</b>
Planned Work	Jul 25, 2025 12:22 PM bens@nationaltab.com
<b>Description</b>	<b>Last Updated</b>
WIC lightswitch is not connected, causing the lights to be on at all times. Unable to determine if the door sweep is sealed tightly with threshold when door is closed. Only translucent light should be present inspecting from the inside out with box lights off.	Jul 25, 2025 12:22 PM

---

**#263 [REFG 506] [NEW] WIF door sweep vs threshold.**

<b>Status</b>	<b>Start Date</b>
Open	Jul 25, 2025
<b>Type</b>	<b>Created</b>
Planned Work	Jul 25, 2025 12:22 PM bens@nationaltab.com
<b>Description</b>	<b>Last Updated</b>
WIF lightswitch is not connected, causing the lights to be on at all times. Unable to determine if the door sweep is sealed tightly with threshold when door is closed. No light should be present inspecting from the inside out with box lights off.	Jul 25, 2025 12:22 PM

---

**#262 [REFG 510] [NEW] WIC/WIF Heated pressure relief vents.**

<b>Status</b>	<b>Start Date</b>
Open	Jul 25, 2025
<b>Type</b>	<b>Created</b>
Planned Work	Jul 25, 2025 12:22 PM bens@nationaltab.com
<b>Description</b>	<b>Last Updated</b>
WIC/WIF heated pressure relief vents not wired.	Jul 25, 2025 12:22 PM

---

## #261 [REFG 511] [NEW] PVC pipe chase (gooseneck) installation.

**Status**

Open

**Start Date**

Jul 25, 2025

**Type**

Planned Work

**Created**

Jul 25, 2025 12:22 PM  
bens@nationaltab.com

**Description**

PVC pipe chase risers are not sealed with spray foam and silicone to prevent weather/pest infiltration.

**Last Updated**

Jul 25, 2025 12:27 PM

**Photos**



IMG\_1991

**Ben Searles**

Jul 25, 2025 12:27 PM

## #260 [REFG 516] [NEW] Condenser electrical disconnects.

<b>Status</b> Open	<b>Start Date</b> Jul 25, 2025
<b>Type</b> Planned Work	<b>Created</b> Jul 25, 2025 12:22 PM bens@nationaltab.com
<b>Description</b> Electrical disconnects are not properly labeled.	<b>Last Updated</b> Jul 25, 2025 12:27 PM

### Photos



IMG\_1990  
Ben Searles  
Jul 25, 2025 12:27 PM

**#259 [REFG 999] [NEW] (MISC) WIF/WIC not operational.**

**Status**

Open

**Start Date**

Jul 25, 2025

**Type**

Planned Work

**Created**

Jul 25, 2025 12:22 PM  
bens@nationaltab.com

**Description**

The WIC/WIF are not operational at the time of inspection.

**Last Updated**

Jul 25, 2025 12:22 PM

---