

Report By:

National TAB
1329 E. KEMPER ROAD
SUITE 4210
CINCINNATI, OH 45246



Report: Punch Lst
Function: Test, Adjust, & Balance
Date: 02/24/2025
Completed By: National TAB

PROJECT

Kenton County School Ops Ctr (Independence, KY)

11800 Taylor Mill Rd

Independence, KY 41051

Client

Hudson Piping Inc.

836 Walnut St.

Dayton, KY 41074

National TAB

Project: Kenton County School Ops Ctr (Independence, KY)

Table Of Contents

Section	Page #
Issue Data	3

Issue List

- AirFlow station
- EF 8 Missing Grille
- EF Speed Controllers
- EF-6 Motorized backdraft damper not opening fully.
- EF-6 Speed controller rating does not match motor rating.
- EF-7 Needs sheave change.



Kenton County School Ops Ctr (Independence, KY)

Project Issue Information

Issue Name : AirFlow station
Description : AirFlow Station not communicating with RTU oa damper. This is preventing the unit from keeping oa flow within design tolerances. Unable to start return balance until the issue is resolved.
Created By : National TAB **Assigned To :** National TAB - Nick Payne
Status : Open
Priority : Urgent **Asset Tag :**
Originated Date : 02/28/2025 - Gabe Merk - National TAB




Kenton County School Ops Ctr (Independence, KY)

Project Issue Information

Issue Name : EF 8 Missing Grille
Description : EF 8 missing grille 1. Unable to balance fan total without install.
Created By : National TAB **Assigned To :** National TAB - Nick Payne
Status : Open
Priority : Medium **Asset Tag :**
Originated Date : 02/28/2025 - Gabe Merk - National TAB

Project Issue File Details

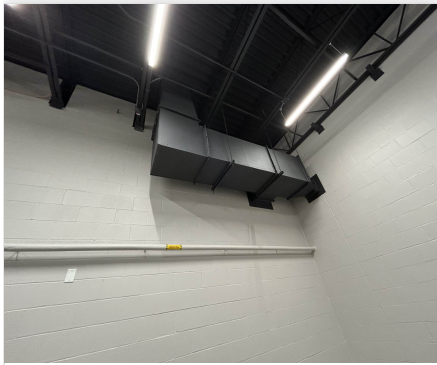

02/28/2025



Kenton County School Ops Ctr (Independence, KY)

Project Issue Information

Issue Name : EF Speed Controllers
Description : Efs 1, 3, 4, and 5 require speed controllers in order to reach design lfows.
Created By : National TAB **Assigned To :** National TAB - Nick Payne
Status : Open
Priority : High **Asset Tag :**
Originated Date : 02/28/2025 - Gabe Merk - National TAB



Kenton County School Ops Ctr (Independence, KY)

Project Issue Information

Issue Name : EF-6 Motorized backdraft damper not opening fully.
Description : EF-6 Motorized backdraft damper not opening fully. Opening approximately 70%.
Created By : National TAB **Assigned To :** National TAB - Nick Payne
Status : Open
Priority : High **Asset Tag :** EF-06
Originated Date : 02/28/2025 - Cody Collett - National TAB

Project Issue File Details



02/28/2025



Kenton County School Ops Ctr (Independence, KY)

Project Issue Information

Issue Name : EF-6 Speed controller rating does not match motor rating.
Description : EF-6 Speed controller rating does not match motor rating. Speed controller rated for 1/8 HP, 120 VAC, 1.9 AMPS, 1199 RPM. Motor is rated for 1/2 HP, 115-208VAC 6.4-4.0 AMPS. Current CFM is 640/940, Current amps are 1.6 AMPS.

Created By : National TAB **Assigned To :** National TAB - Nick Payne
Status : Open
Priority : Urgent **Asset Tag :** EF-06
Originated Date : 02/28/2025 - Cody Collett - National TAB

Project Issue File Details



02/28/2025



02/28/2025



Kenton County School Ops Ctr (Independence, KY)

Project Issue Information

Issue Name : EF-7 Needs sheave change.
Description : EF-7 motor sheave is fully open and CFM is 12% above design. Sheave change required to meet design.
Created By : National TAB **Assigned To :** National TAB - Nick Payne
Status : Open
Priority : Urgent **Asset Tag :** EF-07
Originated Date : 02/28/2025 - Cody Collett - National TAB