



Comfort. Under control.

12-05 CULVERS - LAKE CITY, FL

Project Issue Information

Issue Name : RTU30A CFM is above design.

Description : Currently running at 4062 cfm out of a designed 3250. Motor sheave turned to minimum setting, however cfm is still too high and motor is overamping. Recommended to replace fan sheave to a BK90 with 1.1875" bore. New fan sheave will require a BX57 or BX58 belt.

Created By : National TAB

Assigned To : National TAB - Will Turnbough

Status : Open

Originated Date : 12/08/2022 - Ian Fuller - National TAB