

Issue List

- Drive-thru diffusers are routed from the top of the branch
- EF-2 is not powered
- Inaccessible dampers / No access
- Office damper is inaccessible
- One of the serving line diffuser (RTU-1) is installed in the wrong location
- Serving line diffusers still have the 1x1 deflectors installed



12-04-23 CHIPOTLE #20-3885 MEDFIELD, MA (MEDFIELD)

Project Issue Information

Issue Name : Drive-thru diffusers are routed from the top of the branch
Description : Both drive-thru diffusers are routed from the top of the duct instead of the side. This can cause restriction and lower the efficiency of air coming out of the diffusers.
Created By : National TAB **Assigned To :** National TAB - David Annan
Status : Open
Priority : **Asset Tag :**
Originated Date : 12/06/2023 - David Annan - National TAB



12-04-23 CHIPOTLE #20-3885 MEDFIELD, MA (MEDFIELD)

Project Issue Information

Issue Name : EF-2 is not powered
Description : EF-2 is not powered. Unable to to balance unit until electricians can provide power.
Created By : National TAB **Assigned To :** National TAB - David Annan
Status : Open
Priority : **Asset Tag :**
Originated Date : 12/06/2023 - David Annan - National TAB

Project Issue File Details



EF-2_no_power
12/06/2023



12-04-23 CHIPOTLE #20-3885 MEDFIELD, MA (MEDFIELD)

Project Issue Information

Issue Name : Inaccessible dampers / No access
Description : RTU-2 side wall diffusers do have dampers with access. Unable to complete diffuser balance. Unit total air flow will be balanced to design. Recommend installing integral dampers.
Created By : National TAB **Assigned To :** National TAB - David Annan
Status : Open
Priority : **Asset Tag :**
Originated Date : 12/06/2023 - David Annan - National TAB

Project Issue File Details



Inaccessible_damper.j..
12/06/2023



12-04-23 CHIPOTLE #20-3885 MEDFIELD, MA (MEDFIELD)

Project Issue Information

Issue Name : Office damper is inaccessible
Description : The officer diffuser is over design tolerance. Unable to access the diffuse damper. Recommend having a integral damper installed at the diffuser.
Created By : National TAB **Assigned To :** National TAB - David Annan
Status : Open
Priority : **Asset Tag :**
Originated Date : 12/06/2023 - David Annan - National TAB

Project Issue File Details



No_integral_damper.jp..
12/06/2023



12-04-23 CHIPOTLE #20-3885 MEDFIELD, MA (MEDFIELD)

Project Issue Information

Issue Name : One of the serving line diffuser (RTU-1) is installed in the wrong location
Description : There is one serving line diffuser installed by the walk-in cooler instead of the serving line as shown per MSET.
Created By : National TAB **Assigned To :** National TAB - David Annan
Status : Open
Priority : **Asset Tag :**
Originated Date : 12/06/2023 - David Annan - National TAB

Project Issue File Details



Diffuserwronglocation..
12/06/2023



Correct_serving_line_..
12/06/2023



12-04-23 CHIPOTLE #20-3885 MEDFIELD, MA (MEDFIELD)

Project Issue Information

Issue Name : Serving line diffusers still have the 1x1 deflectors installed
Description : All serving line diffusers need to have the 1x1 deflectors removed.
Created By : National TAB **Assigned To :** National TAB - David Annan
Status : Open
Priority : **Asset Tag :**
Originated Date : 12/06/2023 - David Annan - National TAB

Project Issue File Details



Deflectors_installed_..
12/06/2023