

PlanGrid Task Report - Jan 7, 2025

Prepared by Dale Wheeler

Jan 7, 2025

Description

5 tasks in this report.

Contents

#530 [EXHA 500] [NEW] Restroom rectangular duct riser.	2
#529 [EXHA 003] [NEW] CRITICAL – Incorrect grease exhaust duct ells.	4
#528 [EXHA 001] [NEW] CRITICAL – Grease duct access doors.	6
#527 [DUCT 006] [NEW] CRITICAL – Flex duct installation.	8
#526 [UNIT 510] [NEW] Gas inlet grommet.	9

#530 [EXHA 500] [NEW] Restroom rectangular duct riser.

Status

Open

Start Date

Jan 6, 2025

Type

Planned Work

Created

Jan 7, 2025 11:09 AM
dale@nationaltab.com

Description

Restroom exhaust rectangular duct riser not correctly lined per specification. Liner is not installed below back draft damper; liner should be installed entire length of square duct.

Last Updated

Jan 7, 2025 11:18 AM

Photos



IMG_6639

Dale Wheeler

Jan 7, 2025 11:09 AM

#529 [EXHA 003] [NEW] CRITICAL – Incorrect grease exhaust duct ells.

Status

Open

Start Date

Jan 6, 2025

Type

Planned Work

Created

Jan 7, 2025 11:09 AM
dale@nationaltab.com

Description

EF2 has two grease duct turns that do not have long radius turns installed. Grease ductwork not constructed with long radius centerline $R=3W/2$ fittings per specification. Short radius, mitered ells, and offsets greater than 45 degrees are not allowed.

Last Updated

Jan 7, 2025 11:21 AM

Photos



IMG_6638

Dale Wheeler

Jan 7, 2025 11:09 AM

#528 [EXHA 001] [NEW] CRITICAL – Grease duct access doors.

Status

Open

Start Date

Jan 6, 2025

Type

Planned Work

Created

Jan 7, 2025 11:08 AM
dale@nationaltab.com

Description

EF2 per prints has 5
incorrect sized grease
cleanout doors installed.
EF1 per prints has 3
incorrect sized grease
cleanout doors installed.
Page: M-250
Detail: 1

Last Updated

Jan 7, 2025 11:23 AM

Photos



IMG_6640

Dale Wheeler

Jan 7, 2025 11:08 AM



IMG_6641

Dale Wheeler

Jan 7, 2025 11:08 AM

#527 [DUCT 006] [NEW] CRITICAL – Flex duct installation.

Status

Open

Start Date

Jan 6, 2025

Type

Planned Work

Created

Jan 7, 2025 11:08 AM
dale@nationaltab.com

Description

AC2 & AC3 supply grills were spot checked and flex inner core was banded but not also taped. Inner flex core should be banded and also taped.

Last Updated

Jan 7, 2025 11:30 AM

Photos



IMG_6642

Dale Wheeler

Jan 7, 2025 11:08 AM

#526 [UNIT 510] [NEW] Gas inlet grommet.

Status

Open

Start Date

Jan 6, 2025

Type

Planned Work

Created

Jan 7, 2025 11:07 AM
dale@nationaltab.com

Description

AC1 gas inlet grommet is missing at the gas line/RTU penetration point.

Last Updated

Jan 7, 2025 11:33 AM

Photos



IMG_6636

Dale Wheeler

Jan 7, 2025 11:07 AM