

# PlanGrid Task Report - Oct 6, 2025

Prepared by Dylan Crisman

Oct 6, 2025

## Description

23 tasks in this report.

## Contents

#326 [SITE 010] [NEW] CRITICAL – Return visit required. .... 3

#325 [DUCT 020] [NEW] CRITICAL – Branch ductwork deficiency. .... 4

#319 [DUCT 007] [NEW] CRITICAL – Diffuser rigid 90's. .... 6

#318 [CURT 501] [NEW] Air curtain power. .... 8

#317 [CURT 503] [NEW] Air curtain door switches. .... 9

#316 [UNIT 527] [NEW] Equipment refrigeration. .... 10

#315 [DUCT 502] [NEW] Restroom round exhaust duct insulation..... 11

#314 [REFG 501] [NEW] WIC/WIF evaporator fans. .... 12

#313 [REFG 511] [NEW] PVC pipe chase (gooseneck) installation..... 13

#267 [HOOD 005] CRITICAL - Hood slider filter bracket bolt. .... 14

#264 [DUCT 015] [NEW] CRITICAL – Air device wrong type. .... 15

#262 [UNIT 510] [NEW] Gas inlet grommet. .... 17

#31 [DUCT 005] [NEW] CRITICAL – Duct leaks observed. .... 19

#27 [CNTL 509] [NEW] Ansul pull labeling. .... 21

#25 [CURT 504] [NEW] Air curtain remote switch labeling. .... 22

#22 [EXHA 507] [NEW] Exhaust fan drain line..... 23

#18 [EXHA 999] [NEW] (MISC) [Damage to EF-1 access Door] ..... 26

#16 [HOOD 512] [NEW] Grease cup and fry chute..... 28

#14 [UNIT 501] [NEW] Equipment low voltage diagrams..... 30

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825

#13 [UNIT 506] [NEW] Equipment GFI outlets..... 31

#12 [UNIT 517] [NEW] Condensate piping construction. .... 33

#11 [DUCT 503] [NEW] Damper flags..... 34

#10 [DUCT 507] [NEW] Ductwork is not fully insulated..... 35

**#326 [SITE 010] [NEW] CRITICAL – Return visit required.**

**Status**

Open

**Start Date**

Oct 1, 2025

**Type**

Planned Work

**Created**

Oct 6, 2025 5:48 PM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Oct 6, 2025 5:48 PM

**Description**

Due to the CRITICAL tasks, a return TAB visit is required. Once all Tasks are completed and correction photos imported to PG, reach out to the TAB Supervisor for confirmation and scheduling the revisit. Contact the TAB Supervisor if a TAB report is needed for CO or for further diagnostics.

---

**#325 [DUCT 020] [NEW] CRITICAL – Branch ductwork deficiency.**

**Status**

Open

**Start Date**

Oct 1, 2025

**Type**

Planned Work

**Created**

Oct 6, 2025 5:48 PM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Oct 6, 2025 5:48 PM

**Description**

SA and/or RA branch ductwork not connected to a diffuser or duct missing. Duct for EF-3 Restroom is not complete.

**Photos**

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825



IMG\_7473

**Dylan Crisman**

Oct 6, 2025 5:48 PM

## #319 [DUCT 007] [NEW] CRITICAL – Diffuser rigid 90's.

**Status**

Open

**Start Date**

Oct 1, 2025

**Type**

Planned Work

**Created**

Oct 2, 2025 1:56 PM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Oct 2, 2025 2:09 PM

**Description**

Ensure rigid 90 degree fittings are secured to diffusers, with hard pipe risers adjusted to meet take off height elevation and connected to horizontal flex. No flex in drops allowed per details. Diffuser 3-19 above checkout  
Counter is flexed and not hard pipe 90 to diffuser.

**Photos**

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825



IMG\_9174

**Dylan Crisman**

Oct 2, 2025 2:08 PM



IMG\_9175

**Dylan Crisman**

Oct 2, 2025 2:08 PM

## #318 [CURT 501] [NEW] Air curtain power.

**Status**

Open

**Start Date**

Oct 1, 2025

**Type**

Planned Work

**Created**

Oct 2, 2025 1:56 PM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Oct 2, 2025 2:09 PM

**Description**

Air curtain power does not cycle properly from local disconnect at time of TAB inspection. Could not test functionality of air curtains during TAB.

**Photos**



IMG\_9177

Dylan Crisman

Oct 2, 2025 2:09 PM

---

### #317 [CURT 503] [NEW] Air curtain door switches.

**Status**

Open

**Start Date**

Oct 1, 2025

**Type**

Planned Work

**Created**

Oct 2, 2025 1:56 PM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Oct 2, 2025 1:56 PM

**Description**

Air curtain magnetic door switches are not installed correctly or not properly controlling mode activation in

Auto at time of TAB inspection.

---

**#316 [UNIT 527] [NEW] Equipment refrigeration.**

**Status**

Open

**Start Date**

Oct 1, 2025

**Type**

Planned Work

**Created**

Oct 2, 2025 1:56 PM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Oct 2, 2025 2:10 PM

**Description**

Equipment compressor(s) not operating properly or refrigeration appears to not be adequate and is affecting conditioning performance. AC-3 cooling not functional, component test force closes when opened on CORE app. Dining room stayed around 78-80 degrees during week of TAB

---

## #315 [DUCT 502] [NEW] Restroom round exhaust duct insulation.

**Status**

Open

**Start Date**

Oct 1, 2025

**Type**

Planned Work

**Created**

Oct 2, 2025 1:56 PM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Oct 6, 2025 5:36 PM

**Description**

Restroom round exhaust duct is to be externally insulated to mitigate noise per mechanical specifications.

**Photos**



IMG\_7473

Dylan Crisman

Oct 6, 2025 5:36 PM

---

### #314 [REFG 501] [NEW] WIC/WIF evaporator fans.

**Status**

Open

**Start Date**

Oct 1, 2025

**Type**

Planned Work

**Created**

Oct 2, 2025 1:56 PM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Oct 2, 2025 1:56 PM

**Description**

WIC/WIF evaporator fans are not all operational or spinning freely.

### #313 [REFG 511] [NEW] PVC pipe chase (gooseneck) installation.

**Status**

Open

**Start Date**

Oct 1, 2025

**Type**

Planned Work

**Created**

Oct 2, 2025 1:56 PM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Oct 2, 2025 1:56 PM

**Description**

PVC pipe chase risers are not constructed to drawing or is not sealed with spray foam to prevent weather/pest infiltration.

---

## #267 [HOOD 005] CRITICAL - Hood slider filter bracket bolt.

**Status**

Open

**Created**

Sep 30, 2025 2:11 PM  
dylanc@nationaltab.com

**Type**

Planned Work

**Last Updated**

Sep 30, 2025 2:12 PM

**Description**

Hood-3 slider bracket that secured fitment tightness has a bolt missing, unable to secure filter bank to remove gaps in filters.

**Photos**



IMG\_9161

Dylan Crisman

Sep 30, 2025 2:12 PM

**#264 [DUCT 015] [NEW] CRITICAL – Air device wrong type.**

**Status**

Open

**Start Date**

Sep 30, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 1:53 PM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Sep 30, 2025 1:56 PM

**Description**

Diffuser does not match specified type on air device schedule. Diffuser 4-7 in riser room is egg crate return style diffuser.

**Photos**

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825



IMG\_9149

**Dylan Crisman**

Sep 30, 2025 1:55 PM

## #262 [UNIT 510] [NEW] Gas inlet grommet.

**Status**

Open

**Start Date**

Sep 30, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 1:53 PM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Sep 30, 2025 1:56 PM

**Description**

AC gas inlet grommet is missing at the gas line/RTU penetration point.

**Photos**

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825



IMG\_9153

**Dylan Crisman**

Sep 30, 2025 1:56 PM

**#31 [DUCT 005] [NEW] CRITICAL – Duct leaks observed.**

**Status**

Open

**Start Date**

Sep 29, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 9:31 AM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Sep 30, 2025 1:40 PM

**Description**

Ensure duct is sealed at all start collars, traverse joints, seams, and connections to air device collars. Review all.

**Photos**

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825



IMG\_9146  
**Dylan Crisman**  
Sep 30, 2025 1:40 PM



IMG\_9159  
**Dylan Crisman**  
Sep 30, 2025 1:40 PM

## #27 [CNTL 509] [NEW] Ansul pull labeling.

**Status**

Open

**Start Date**

Sep 29, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 9:31 AM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Sep 30, 2025 1:41 PM

**Description**

Label all ansul pull stations for which hoods they serve.

**Photos**



IMG\_9077

Dylan Crisman

Sep 30, 2025 1:41 PM



IMG\_9080

Dylan Crisman

Sep 30, 2025 1:41 PM

## #25 [CURT 504] [NEW] Air curtain remote switch labeling.

**Status**

Open

**Start Date**

Sep 29, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 9:31 AM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Sep 30, 2025 9:31 AM

**Description**

Air curtain remote switches are not clearly marked for mode operation.

---

## #22 [EXHA 507] [NEW] Exhaust fan drain line.

**Status**

Open

**Start Date**

Sep 29, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 9:31 AM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Oct 2, 2025 1:46 PM

**Description**

Exhaust fan drain is not properly installed, pitched, or routed to center of drip guard per detail. If gas piping is used, will need to be painted for rust protection.

**Comments**

10/01/25 drip guard is installed on the left side of the EF, plans show to install underneath the front side of housing. PVC drain needs to be glued together.

Dylan Crisman Oct 2, 2025

**Photos**

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825



IMG\_7472

**Dylan Crisman**

Oct 2, 2025 1:45 PM



IMG\_7471

**Dylan Crisman**

Oct 2, 2025 1:45 PM

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825



IMG\_9099

**Dylan Crisman**

Sep 30, 2025 1:43 PM

## #18 [EXHA 999] [NEW] (MISC) [Damage to EF-1 access Door]

**Status**

Open

**Start Date**

Sep 29, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 9:31 AM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Sep 30, 2025 1:44 PM

**Description**

There is damage on the  
Access door to the blower  
compartment for EF-1.

**Photos**

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825



IMG\_9122

**Dylan Crisman**

Sep 30, 2025 1:44 PM

**#16 [HOOD 512] [NEW] Grease cup and fry chute.**

**Status**

Open

**Start Date**

Sep 29, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 9:31 AM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Sep 30, 2025 1:45 PM

**Description**

Hood is missing its grease cup and / or fry chute. HD-2/ HD-3

**Photos**

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825



IMG\_9144

**Dylan Crisman**

Sep 30, 2025 1:45 PM



IMG\_9145

**Dylan Crisman**

Sep 30, 2025 1:45 PM

## #14 [UNIT 501] [NEW] Equipment low voltage diagrams

**Status**

Open

**Start Date**

Sep 29, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 9:31 AM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Sep 30, 2025 1:46 PM

**Description**

Equipment missing  
laminated copy of controls  
detail low voltage wiring  
diagrams.

**Photos**

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825



IMG\_9118

Dylan Crisman

Sep 30, 2025 1:46 PM

---

**#13 [UNIT 506] [NEW] Equipment GFI outlets.**

**Status**

Open

**Start Date**

Sep 29, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 9:31 AM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Sep 30, 2025 9:31 AM

**Description**

Equipment GFI outlet  
missing components (GFI

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825

itself, din rail with fuses) or  
not terminated/operational.

---

## #12 [UNIT 517] [NEW] Condensate piping construction.

**Status**

Open

**Start Date**

Sep 29, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 9:31 AM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Oct 1, 2025 9:56 AM

**Description**

Equipment condensate piping or p-trap is not constructed per normal CFA specifications.

**Photos**

**L05825\_Munford FSU (TN)**

11103 U.S. 51, Atoka, Tennessee

L1020005825



IMG\_9107  
Dylan Crisman  
Oct 1, 2025 9:56 AM



IMG\_9108  
Dylan Crisman  
Oct 1, 2025 9:56 AM

---

**#11 [DUCT 503] [NEW] Damper flags.**

**Status**

Open

**Start Date**

Sep 29, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 9:31 AM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Sep 30, 2025 9:31 AM

**Description**

Dampers are not flagged per specification.

## #10 [DUCT 507] [NEW] Ductwork is not fully insulated.

**Status**

Open

**Start Date**

Sep 29, 2025

**Type**

Planned Work

**Created**

Sep 30, 2025 9:31 AM  
dylanc@nationaltab.com

**List**

TAB Punch List

**Last Updated**

Sep 30, 2025 9:31 AM

**Description**

Ductwork has exposed metal ductwork in some areas needs to be fully wrapped.

---