

## Issue List

- AHU-1 Flex Duct Issues - Manager's Office
- AHU-1 Hallway Diffuser Damper Not Located
- AHU-1 Room 6 Supply Duct Undersized
- EF-1 Not Installed
- EF-2, EF-3, and EF-4 Not Running



## Homesense Uptown Boca (Boca Raton, FL)

### Project Issue Information

**Issue Name :** AHU-1 Flex Duct Issues - Manager's Office  
**Description :** The flex duct is folded at 90 degree angles and therefore restrictive leading to both supply diffusers in the Manager's Office (Room 3). As a result these diffusers are at 119CFM and 162CFM out of 225CFM design.  
**Created By :** National TAB                      **Assigned To :** National TAB - Stephen Tassinaro  
**Status :** Open  
**Priority :** Urgent                                      **Asset Tag :**  
**Originated Date :** 12/05/2024 - Stephen Tassinaro - National TAB

#### Project Issue File Details



12/05/2024



12/05/2024




## Homesense Uptown Boca (Boca Raton, FL)

### Project Issue Information

**Issue Name :** AHU-1 Hallway Diffuser Damper Not Located  
**Description :** No balancing damper could be located for the supply diffuser in the Hallway (Room 8). As a result the airflow is currently 284CFM out of 150CFM design.  
**Created By :** National TAB **Assigned To :** National TAB - Stephen Tassinaro  
**Status :** Open  
**Priority :** **Urgent** **Asset Tag :**  
**Originated Date :** 12/05/2024 - Stephen Tassinaro - National TAB

#### Project Issue File Details

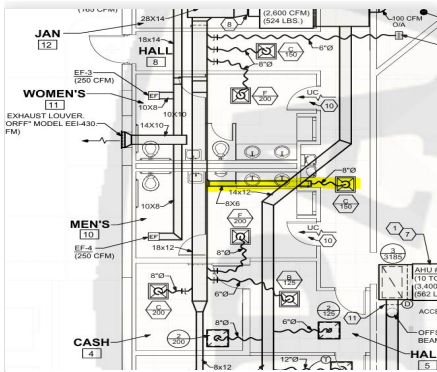

12/05/2024



12/05/2024



12/05/2024




## Homesense Uptown Boca (Boca Raton, FL)


### Project Issue Information

**Issue Name :** AHU-1 Room 6 Supply Duct Undersized  
**Description :** The currently installed supply duct in Room 6 (LP) is 6" diameter and outputting 98CFM out of 150CFM design. The mechanical plans call for an 8" duct to be ran to this room.  
**Created By :** National TAB                      **Assigned To :** National TAB - Stephen Tassinaro  
**Status :** Open  
**Priority :** **Urgent**                                      **Asset Tag :**  
**Originated Date :** 12/05/2024 - Stephen Tassinaro - National TAB

#### Project Issue File Details

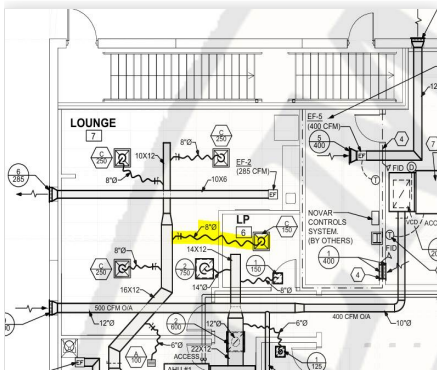

12/05/2024

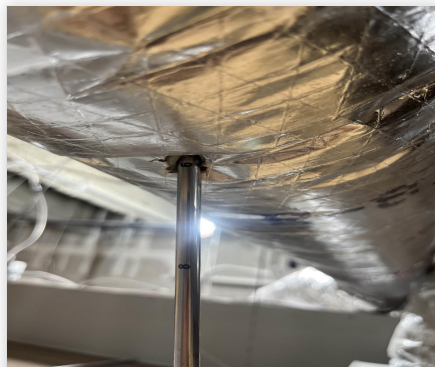

12/05/2024




## Homesense Uptown Boca (Boca Raton, FL)

### Project Issue Information

**Issue Name :** EF-1 Not Installed  
**Description :** Ceiling mount exhaust fan is not installed at this time.  
**Created By :** National TAB                      **Assigned To :** National TAB - Stephen Tassinaro  
**Status :** Open  
**Priority :** Urgent                                      **Asset Tag :**  
**Originated Date :** 12/05/2024 - Stephen Tassinaro - National TAB

#### Project Issue File Details

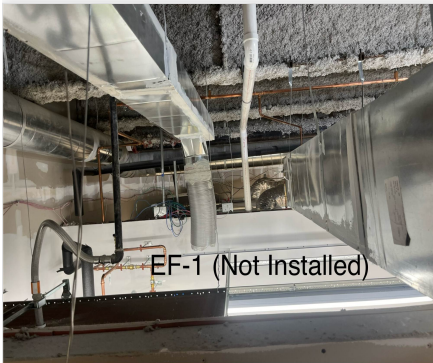

12/05/2024



## Homesense Uptown Boca (Boca Raton, FL)


### Project Issue Information

**Issue Name :** EF-2, EF-3, and EF-4 Not Running  
**Description :** Ceiling mount exhaust fans 2, 3, and 4 are not running at this time. The electrician stated there was an RFI and he is waiting on 120v transformers.  
**Created By :** National TAB                      **Assigned To :** National TAB - Stephen Tassinaro  
**Status :** Open  
**Priority :** Urgent                                      **Asset Tag :**  
**Originated Date :** 12/05/2024 - Stephen Tassinaro - National TAB


#### Project Issue File Details



12/05/2024

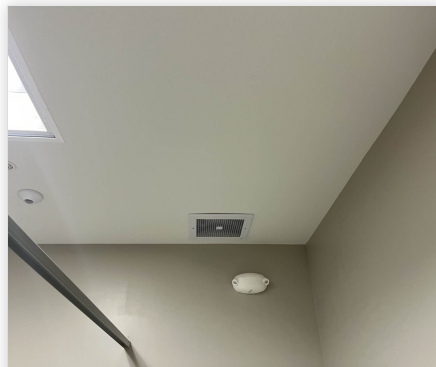

12/05/2024

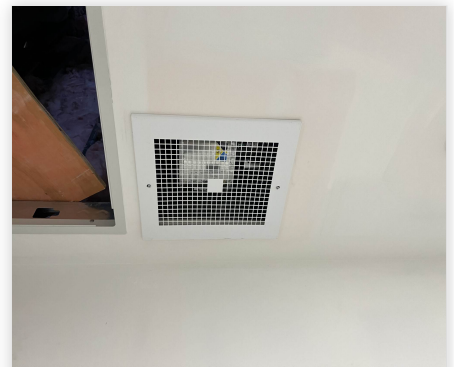

12/05/2024