

**Report By:**

National TAB  
1329 E. KEMPER ROAD  
SUITE 4210  
CINCINNATI, OH 45246



**Report: Punchlist**  
**Function: Test, Adjust, & Balance**  
**Date: 07/19/2023**

**PROJECT**  
**07-17-2023 CULVERS - LAKE ORION, MI**

Brown Avenue

Lake Orion, MI 48607

**Client**

Accurex  
PO Box 410  
Schofield, WI 54476

# National TAB

Project: 07-17-2023 CULVERS - LAKE ORION, MI

## Table Of Contents

Section	Page #
Issue Data	3

## Issue List

- PRV-1 no dampers
- RTU-1 dampers missing
- RTU-2 damper
- RTU-2 diffusers without dampers
- RTU-2 missing dampers



**07-17-2023 CULVERS - LAKE ORION, MI**

**Project Issue Information**

**Issue Name :** PRV-1 no dampers  
**Description :** PRV-1 has no dampers installed for any of the 3 exhaust grilles in each bathroom. Diffuser 1 and 2 are in design. Diffuser 3 (kitchen restroom) is at the same as other 2 in terms of flow. But without damper I'm unable to reduce exhaust to kitchen restroom.  
**Created By :** National TAB                      **Assigned To :** National TAB - Dylan Crisman  
**Status :** Open  
**Originated Date :** 07/19/2023 - Dylan Crisman - National TAB

Project Issue File Details



**PRV13**  
**07/19/2023**



**Ductwork above restroom..**  
**07/19/2023**



**07-17-2023 CULVERS - LAKE ORION, MI**

**Project Issue Information**

**Issue Name :** RTU-1 dampers missing  
**Description :** Diffuser 1-9 and 1-13 dampers are broken. Was able to move damper plate to get airFlow into design. Recommend installing new dampers.  
**Created By :** National TAB                      **Assigned To :** National TAB - Dylan Crisman  
**Status :** Open  
**Originated Date :** 07/19/2023 - Dylan Crisman - National TAB



**07-17-2023 CULVERS - LAKE ORION, MI**

**Project Issue Information**

**Issue Name :** RTU-2 damper  
**Description :** Diffuser 2-8 damper shows very little change in flow when fully open or fully closed. Damper moves freely, tightened wingnut, no difference. Damper plate has no resistance when moved, don't suspect blockage.  
**Created By :** National TAB                      **Assigned To :** National TAB - Dylan Crisman  
**Status :** Open  
**Originated Date :** 07/19/2023 - Dylan Crisman - National TAB

Project Issue File Details



2-8  
07/19/2023



**07-17-2023 CULVERS - LAKE ORION, MI**

**Project Issue Information**

**Issue Name :** RTU-2 diffusers without dampers  
**Description :** Damper 2-1 and 2-2 unable to locate dampers. Flow is close to design but will need them installed to properly balance.  
**Created By :** National TAB                      **Assigned To :** National TAB - Dylan Crisman  
**Status :** Open  
**Originated Date :** 07/19/2023 - Dylan Crisman - National TAB

Project Issue File Details



**DIFFUSER2-1circled2-2..  
07/19/2023**



**07-17-2023 CULVERS - LAKE ORION, MI**

**Project Issue Information**

**Issue Name :** RTU-2 missing dampers  
**Description :** Dampers in kitchen missing dampers 1. 2-4 has no damper flow is reading 730/375CFM 2. 2-3 damper is broken flow is in design but will need to be installed to be properly balanced.  
**Created By :** National TAB                      **Assigned To :** National TAB - Dylan Crisman  
**Status :** Open  
**Originated Date :** 07/19/2023 - Dylan Crisman - National TAB

Project Issue File Details



2-3missingdamper  
07/19/2023



2-4  
07/19/2023



2-4  
07/19/2023