

# PlanGrid Task Report - Feb 18, 2025

Prepared by Dale Wheeler

Feb 17, 2025

## Description

13 tasks in this report.

## Contents

#353 [UNIT 520] [NEW] Equipment option(s) not operational.....	2
#351 [CNTL 012] [NEW] CRITICAL (BAS) – Wiring specification.....	3
#350 [CNTL 012] [NEW] CRITICAL (BAS) – Wiring specification.....	5
#349 [UNIT 999] [NEW] (MISC) [AC2 Condensate line obstruction].....	6
#348 [UNIT 514] [NEW] Equipment gas piping. ....	7
#347 [UNIT 505] [NEW] Equipment wiring portals. ....	8
#346 [REFG 508] [NEW] WIC/WIF panel penetrations.....	9
#345 [REFG 500] [NEW] WIC/WIF temperatures. ....	10
#344 [UNIT 999] [NEW] (MISC) [MINI SPLIT].....	11
#343 [REFG 999] [NEW] (MISC) [WIC & WIF ELECRTICAL] .....	12
#342 [REFG 517] [NEW] Hail guards.....	13
#341 [EXHA 510] [NEW] Grease exhaust duct stands. ....	14
#340 [CNTL 509] [NEW] Ansul pull labeling. ....	15

## #353 [UNIT 520] [NEW] Equipment option(s) not operational.

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:19 PM  
dale@nationaltab.com

**Description**

AC1 has one power exhaust fan that is not operational and appears fan blades are bound up against the fan housing.

**Last Updated**

Feb 17, 2025 8:30 PM

**Photos**



IMG\_7086

**Dale Wheeler**

Feb 17, 2025 7:20 PM

---

## #351 [CNTL 012] [NEW] CRITICAL (BAS) – Wiring specification.

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:16 PM  
dale@nationaltab.com

**Description**

AC1, AC2, AC3, AC4  
humidity sensor wiring used  
is incorrect per plans:  
SHIELDED CABLE BY MC.  
NETWORK THERMOSTAT  
CONNECT-AIR  
W1812C-2148,  
HONEYWELL GENESIS  
TWP-18/12 (47690112) OR  
EQUAL . 18AWG, 1-PAIR,  
TWISTED,  
SHIELDED, WITH DRAIN.  
PLENUM RATED. NO  
SUBSTITUTIONS.

**Last Updated**


Feb 17, 2025 7:27 PM

**Photos**

**01041 South Parkway FSU // Huntsville, AL ...**

11820 Memorial Parkway Southwest, Huntsville, Alabama

01041

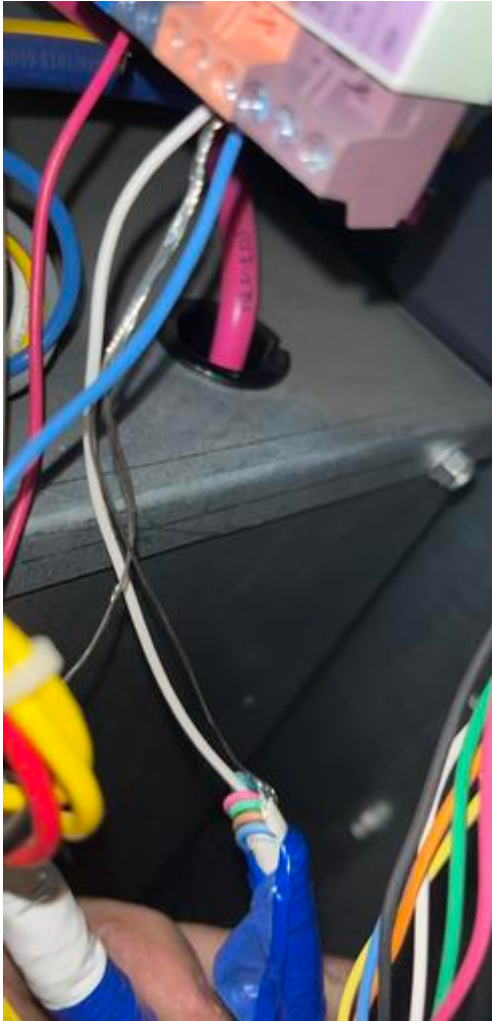

IMG\_7083

**Dale Wheeler**

Feb 17, 2025 7:17 PM

## #350 [CNTL 012] [NEW] CRITICAL (BAS) – Wiring specification.

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:15 PM  
dale@nationaltab.com

**Description**

AC1, AC2, AC3, AC4 temp.  
sensor wiring installed is  
Lake Cable brand. Plans call  
for specifically  
W221P-2003NT.

**Last Updated**

Feb 17, 2025 7:33 PM

### Photos



IMG\_7046

Dale Wheeler

Feb 17, 2025 7:16 PM

01041 South Parkway FSU // Huntsville, AL ...

11820 Memorial Parkway Southwest, Huntsville, Alabama

01041

## #349 [UNIT 999] [NEW] (MISC) [AC2 Condensate line obstruction]

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:12 PM  
dale@nationaltab.com

**Description**

AC2 condensate line obstructs / makes contact with unit filter door.

**Last Updated**

Feb 17, 2025 8:31 PM

**Photos**



IMG\_7035

Dale Wheeler

Feb 17, 2025 7:13 PM

01041 South Parkway FSU // Huntsville, AL ...

11820 Memorial Parkway Southwest, Huntsville, Alabama

01041

## #348 [UNIT 514] [NEW] Equipment gas piping.

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:12 PM  
dale@nationaltab.com

**Description**

AC2 & AC3 gas pipe  
grommets are not installed

**Last Updated**

Feb 17, 2025 7:37 PM

### Photos



IMG\_7031

Dale Wheeler

Feb 17, 2025 7:12 PM



IMG\_7032

Dale Wheeler

Feb 17, 2025 7:12 PM

## #347 [UNIT 505] [NEW] Equipment wiring portals.

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:11 PM  
dale@nationaltab.com

**Description**

AC1, AC2, AC3, AC4  
grommets are not installed  
around the wiring portal for  
the smoke detectors wiring.

**Last Updated**

Feb 17, 2025 7:55 PM

### Photos



IMG\_7034

Dale Wheeler

Feb 17, 2025 7:11 PM

## #346 [REFG 508] [NEW] WIC/WIF panel penetrations.

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:10 PM  
dale@nationaltab.com

**Description**

WIC drain line cut out inside  
the wic box needs to be  
sealed.

**Last Updated**

Feb 17, 2025 8:32 PM

**Photos**



IMG\_7055

Dale Wheeler

Feb 17, 2025 7:10 PM

### #345 [REFG 500] [NEW] WIC/WIF temperatures.

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:09 PM  
dale@nationaltab.com

**Description**

WIC temp. inside the box is 37F & dial reads over 40F. WIC should be holding temp. at 35F. and dial should be calibrated to match actual temp. inside WIC.

**Last Updated**

Feb 17, 2025 8:05 PM

**Photos**



IMG\_7056

Dale Wheeler

Feb 17, 2025 7:10 PM



IMG\_7057

Dale Wheeler

Feb 17, 2025 7:10 PM

### #344 [UNIT 999] [NEW] (MISC) [MINI SPLIT]

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:08 PM  
dale@nationaltab.com

**Description**

Mini split does not have vibration pads installed between the condensing unit and the rack structure.

**Last Updated**

Feb 17, 2025 8:29 PM

**Photos**



IMG\_7044  
Dale Wheeler  
Feb 17, 2025 7:09 PM



IMG\_7043  
Dale Wheeler  
Feb 17, 2025 7:09 PM

## #343 [REFG 999] [NEW] (MISC) [WIC & WIF ELECRTICAL]

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:05 PM  
dale@nationaltab.com

**Description**

WIF & WIC electrical lines are not secured / anchored to condenser stands.

**Last Updated**

Feb 17, 2025 8:34 PM

**Photos**



IMG\_7040

Dale Wheeler

Feb 17, 2025 7:06 PM



IMG\_7039

Dale Wheeler

Feb 17, 2025 7:06 PM

01041 South Parkway FSU // Huntsville, AL ...

11820 Memorial Parkway Southwest, Huntsville, Alabama

01041

## #342 [REFG 517] [NEW] Hail guards.

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:03 PM  
dale@nationaltab.com

**Description**

WIC condenser hail guard is not installed.

**Last Updated**

Feb 17, 2025 8:11 PM

### Photos



IMG\_7041

Dale Wheeler

Feb 17, 2025 7:05 PM

## #341 [EXHA 510] [NEW] Grease exhaust duct stands.

**Status**

Open

**Start Date**

Feb 17, 2025

**Type**

Planned Work

**Created**

Feb 17, 2025 7:02 PM  
dale@nationaltab.com

**Description**

EF1 is missing grease duct support stands at duct drops / turn down through the roof. Grease duct should be supported at all duct drops.

**Last Updated**

Feb 17, 2025 8:17 PM

**Photos**



IMG\_7037

Dale Wheeler

Feb 17, 2025 7:02 PM

01041 South Parkway FSU // Huntsville, AL ...

11820 Memorial Parkway Southwest, Huntsville, Alabama

01041

## #340 [CNTL 509] [NEW] Ansul pull labeling.

### Status

Open

### Start Date

Feb 17, 2025

### Type

Planned Work

### Created

Feb 17, 2025 7:00 PM  
dale@nationaltab.com

### Description

Label all Ansul pull stations  
for which hoods they serve.

### Last Updated

Feb 17, 2025 8:13 PM

### Photos



IMG\_7051

Dale Wheeler

Feb 17, 2025 7:01 PM