

## Issue List

- EF-19 Not Operational
- EF-23 High Flow
- EF-23 Missing Grille
- EF-26 Low Flow
- Missing Damper for Return Grille
- Missing Return Damper in ROOM AXMS CHIEF N153B
- Missing Return Damper in ROOM CTK N131
- Multiple Dampers Missing HANGER SHOP NORTH



## NCANG Repair Bldg 51 (Charlotte, NC)

### Project Issue Information

**Issue Name :** EF-19 Not Operational  
**Description :** EF-19 is not operational. Disconnect, motor starter, and breaker are all on. Motor starter shows a stall fault code (HAND & AUTO FLASHING)  
**Created By :** National TAB                      **Assigned To :** National TAB - Antonio Flores-De La Cruz  
**Status :** Open  
**Priority :** Urgent                                      **Asset Tag :**  
**Originated Date :** 03/09/2026 - Antonio Flores-De La Cruz - National TAB



### NCANG Repair Bldg 51 (Charlotte, NC)

#### Project Issue Information

**Issue Name :** EF-23 High Flow  
**Description :** EF-23 is 37% above design (407 CFM ACTUAL / 300 CFM DESIGN) and requires a sheave change to reduce flow. Motor sheave is on the lowest setting. Unable to balance due to a diffuser missing as well.  
**Created By :** National TAB                      **Assigned To :** National TAB - Antonio Flores-De La Cruz  
**Status :** Open  
**Priority :** Urgent                                      **Asset Tag :**  
**Originated Date :** 02/12/2026 - Antonio Flores-De La Cruz - National TAB




## NCANG Repair Bldg 51 (Charlotte, NC)


### Project Issue Information

**Issue Name :** EF-23 Missing Grille  
**Description :** Grille EF-23-1 in JANITORS E118 is not installed.  
**Created By :** National TAB  
**Assigned To :** National TAB - Antonio Flores-De La Cruz  
**Status :** Open  
**Priority :** High  
**Asset Tag :**  
**Originated Date :** 02/12/2026 - Antonio Flores-De La Cruz - National TAB


#### Project Issue File Details

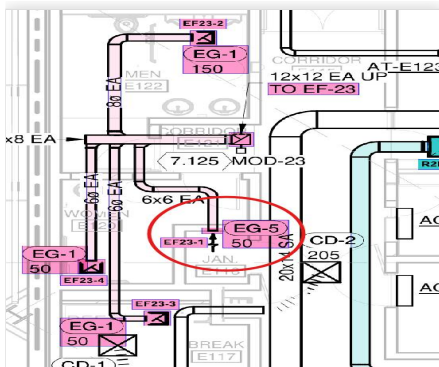

02/12/2026

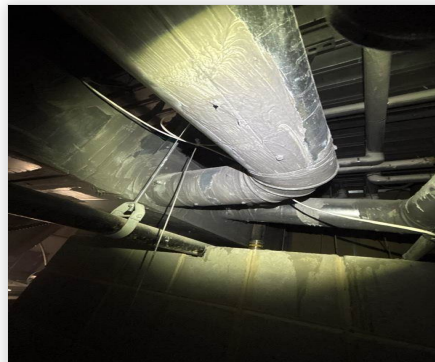

02/12/2026

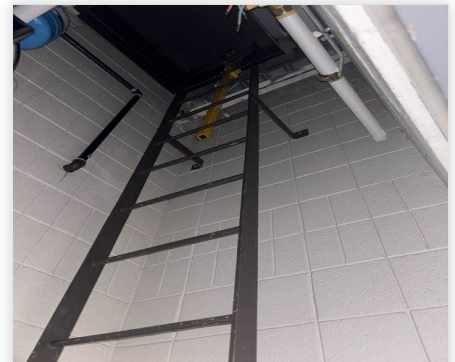

02/12/2026

#### Project Issue Response Details

- **03/30/2026 National TAB - Antonio Flores-De La Cruz**
  - Will not be installed



### NCANG Repair Bldg 51 (Charlotte, NC)

#### Project Issue Information

**Issue Name :** EF-26 Low Flow  
**Description :** EF-26 is at 66% of design (99 CFM ACTUAL / 150 CFM DESIGN). The speed dial is at max. A possible cause could be a partially opened exhaust motorized damper. It was found that there is a damper at the takeoff and one at the arm of the equipment where the duct connects, which may add resistance to the system.

**Created By :** National TAB                      **Assigned To :** National TAB - Antonio Flores-De La Cruz

**Status :** Open

**Priority :** Urgent                                      **Asset Tag :**

**Originated Date :** 02/12/2026 - Antonio Flores-De La Cruz - National TAB

#### Project Issue File Details



02/12/2026

**NCANG Repair Bldg 51 (Charlotte, NC)**


**Project Issue Information**

**Issue Name :** Missing Damper for Return Grille  
**Description :** Return Grille R2E-7 in E107A is missing the damper to balance.  
**Created By :** National TAB **Assigned To :** National TAB - Antonio Flores-De La Cruz  
**Status :** Open  
**Priority :** Urgent **Asset Tag :**  
**Originated Date :** 03/02/2026 - Antonio Flores-De La Cruz - National TAB

Project Issue File Details



03/02/2026

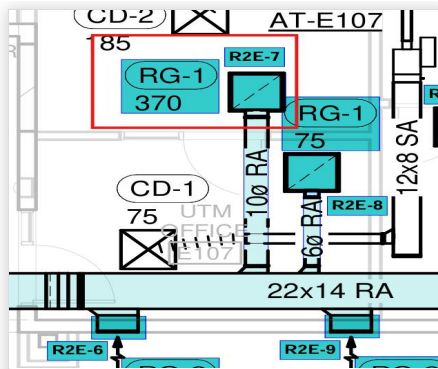

03/02/2026

Project Issue Response Details

- **04/01/2026 National TAB - Antonio Flores-De La Cruz**
  - Installed but during balancing, flow is being restricted. Possible cause could be the transition at the collar reducing flow.



04/01/2026



### NCANG Repair Bldg 51 (Charlotte, NC)


#### Project Issue Information

**Issue Name :** Missing Return Damper in ROOM AXMS CHIEF N153B  
**Description :** Grille R1N-20 is missing the damper to TAB.  
**Created By :** National TAB                      **Assigned To :** National TAB - Antonio Flores-De La Cruz  
**Status :** Open  
**Priority :** Urgent                                      **Asset Tag :**  
**Originated Date :** 03/03/2026 - Antonio Flores-De La Cruz - National TAB

#### Project Issue File Details



03/03/2026

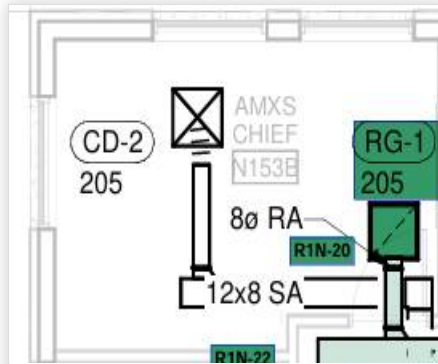

03/03/2026

#### Project Issue Response Details

- **04/02/2026 National TAB - Antonio Flores-De La Cruz**
  - Not Installed.



### NCANG Repair Bldg 51 (Charlotte, NC)


#### Project Issue Information

**Issue Name :** Missing Return Damper in ROOM CTK N131  
**Description :** Grille R1N-30 is missing the damper to TAB.  
**Created By :** National TAB                      **Assigned To :** National TAB - Antonio Flores-De La Cruz  
**Status :** Open  
**Priority :** Urgent                                      **Asset Tag :**  
**Originated Date :** 03/03/2026 - Antonio Flores-De La Cruz - National TAB

#### Project Issue File Details



03/03/2026

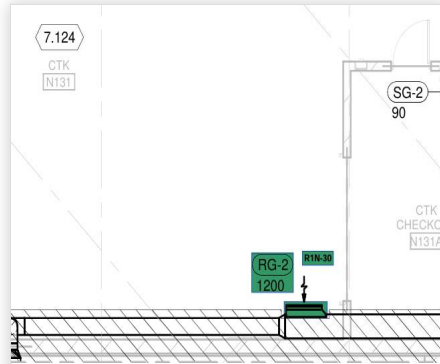

03/03/2026




## NCANG Repair Bldg 51 (Charlotte, NC)

### Project Issue Information

**Issue Name :** Multiple Dampers Missing HANGER SHOP NORTH  
**Description :** Return Grilles R1N-31 through R1N-37, EXCEPT R1N-34, are missing dampers to balance the return.  
**Created By :** National TAB **Assigned To :** National TAB - Antonio Flores-De La Cruz  
**Status :** Open  
**Priority :** Urgent **Asset Tag :**  
**Originated Date :** 03/03/2026 - Antonio Flores-De La Cruz - National TAB

#### Project Issue File Details

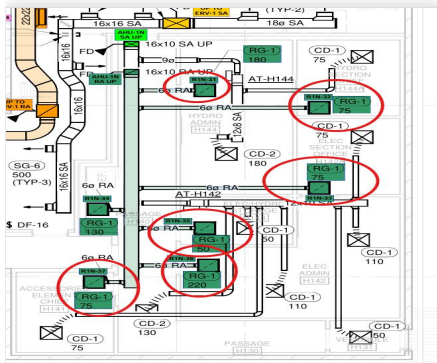

03/03/2026



03/03/2026



03/03/2026