

Report By:

National TAB
1329 E. KEMPER ROAD
SUITE 4210
CINCINNATI, OH 45246



Report: Deficiency Report
Function: Test, Adjust, & Balance
Date: 06/05/2024

PROJECT

06-03-24 WAWA #5434 PALATKA, FL

625 N State Rd

Palatka, FL 32177

Client

Wawa
260 West Baltimore Pike
Wawa, PA 19063

Issue List

- 1.) EF 1 Not Running
- Diffuser 2-7 Flex Duct Restrictive
- Diffuser 2-9 Damper Jammed
- RTU 2 Missing One Final Filter
- RTU 3 Alarm 22



06-03-24 WAWA #5434 PALATKA, FL

Project Issue Information

Issue Name : 1.) EF 1 Not Running
Description : EF 1 was not found to be running while NTi tech was on site. This fan will need to be powered on tomorrow 6/6/24 if it is to be balanced.
Created By : National TAB **Assigned To :** National TAB - Will Turnbough
Status : Open
Priority : Urgent **Asset Tag :**
Originated Date : 06/05/2024 - Stephen Tassinaro - National TAB



06-03-24 WAWA #5434 PALATKA, FL

Project Issue Information

Issue Name : Diffuser 2-7 Flex Duct Restrictive
Description : The flex duct is kinked, causing a restriction, leading to diffuser 2-7. Reference GRD Layout for diffuser location. Current airflow is 297CFM out of 400CFM design (74%). No immediate comfort concerns arose in the Backroom at this airflow.
Created By : National TAB **Assigned To :** National TAB - Will Turnbough
Status : Open
Priority : High **Asset Tag :**
Originated Date : 06/05/2024 - Stephen Tassinaro - National TAB

Project Issue File Details



**FlexRestriction
06/05/2024**



06-03-24 WAWA #5434 PALATKA, FL

Project Issue Information

Issue Name : Diffuser 2-9 Damper Jammed
Description : Diffuser 2-9 damper could not be adjusted as the blade can be heard contacting part of the duct or a screw penetrating the duct. As a result the diffuser is above design airflow, currently 119CFM out of 50CFM design (238%). However, the staging room was not found to be overcooling with this excess airflow.
Created By : National TAB **Assigned To :** National TAB - Will Turnbough
Status : Open
Priority : High **Asset Tag :**
Originated Date : 06/05/2024 - Stephen Tassinaro - National TAB

Project Issue File Details



Jammed_Damper
06/05/2024



06-03-24 WAWA #5434 PALATKA, FL

Project Issue Information

Issue Name : RTU 2 Missing One Final Filter
Description : RTU 2 is missing one of the final filters. Recommend replacing.
Created By : National TAB **Assigned To :** National TAB - Will Turnbough
Status : Open
Priority : Medium **Asset Tag :**
Originated Date : 06/05/2024 - Stephen Tassinaro - National TAB

Project Issue File Details



**MissingFilter
06/05/2024**



06-03-24 WAWA #5434 PALATKA, FL

Project Issue Information

Issue Name : RTU 3 Alarm 22
Description : RTU 3 - Alarm 22 (Low Pressure Switch Compressor 1)
Created By : National TAB **Assigned To :** National TAB - Will Turnbough
Status : Open
Priority : High **Asset Tag :**
Originated Date : 06/05/2024 - Stephen Tassinaro - National TAB

Project Issue File Details

