

Report By:

National TAB  
1329 E. KEMPER ROAD  
SUITE 4210  
CINCINNATI, OH 45246



**Report: Deficiency Report**  
**Function: Test, Adjust, & Balance**  
**Date: 06/05/2024**

# PROJECT

**06-03-24 WAWA #5434 PALATKA, FL**

625 N State Rd

Palatka, FL 32177

Client

Wawa  
260 West Baltimore Pike  
Wawa, PA 19063

## Issue List

- 1.) EF 1 Not Running
- Diffuser 2-7 Flex Duct Restrictive
- Diffuser 2-9 Damper Jammed
- RTU 2 Missing One Final Filter
- RTU 3 Alarm 22



**06-03-24 WAWA #5434 PALATKA, FL**

**Project Issue Information**

**Issue Name :** 1.) EF 1 Not Running  
**Description :** EF 1 was not found to be running while NTi tech was on site. This fan will need to be powered on tomorrow 6/6/24 if it is to be balanced.  
**Created By :** National TAB                      **Assigned To :** National TAB - Will Turnbough  
**Status :** Open  
**Priority :** Urgent                                      **Asset Tag :**  
**Originated Date :** 06/05/2024 - Stephen Tassinaro - National TAB



**06-03-24 WAWA #5434 PALATKA, FL**

**Project Issue Information**

**Issue Name :** Diffuser 2-7 Flex Duct Restrictive  
**Description :** The flex duct is kinked, causing a restriction, leading to diffuser 2-7. Reference GRD Layout for diffuser location. Current airflow is 297CFM out of 400CFM design (74%). No immediate comfort concerns arose in the Backroom at this airflow.

**Created By :** National TAB                      **Assigned To :** National TAB - Will Turnbough

**Status :** Open

**Priority :** High                                      **Asset Tag :**

**Originated Date :** 06/05/2024 - Stephen Tassinaro - National TAB



**06-03-24 WAWA #5434 PALATKA, FL**

**Project Issue Information**

**Issue Name :** Diffuser 2-9 Damper Jammed  
**Description :** Diffuser 2-9 damper could not be adjusted as the blade can be heard contacting part of the duct or a screw penetrating the duct. As a result the diffuser is above design airflow, currently 119CFM out of 50CFM design (238%). However, the staging room was not found to be overcooling with this excess airflow.  
**Created By :** National TAB                      **Assigned To :** National TAB - Will Turnbough  
**Status :** Open  
**Priority :** High                                      **Asset Tag :**  
**Originated Date :** 06/05/2024 - Stephen Tassinaro - National TAB



**06-03-24 WAWA #5434 PALATKA, FL**

**Project Issue Information**

**Issue Name :** RTU 2 Missing One Final Filter  
**Description :** RTU 2 is missing one of the final filters. Recommend replacing.  
**Created By :** National TAB                      **Assigned To :** National TAB - Will Turnbough  
**Status :** Open  
**Priority :** Medium                                      **Asset Tag :**  
**Originated Date :** 06/05/2024 - Stephen Tassinaro - National TAB



06-03-24 WAWA #5434 PALATKA, FL

**Project Issue Information**

**Issue Name :** RTU 3 Alarm 22  
**Description :** RTU 3 - Alarm 22 (Low Pressure Switch Compressor 1)  
**Created By :** National TAB                      **Assigned To :** National TAB - Will Turnbough  
**Status :** Open  
**Priority :** High                                      **Asset Tag :**  
**Originated Date :** 06/05/2024 - Stephen Tassinaro - National TAB