

STORE FRONT


RTU-1



RTU-2

RTU-3



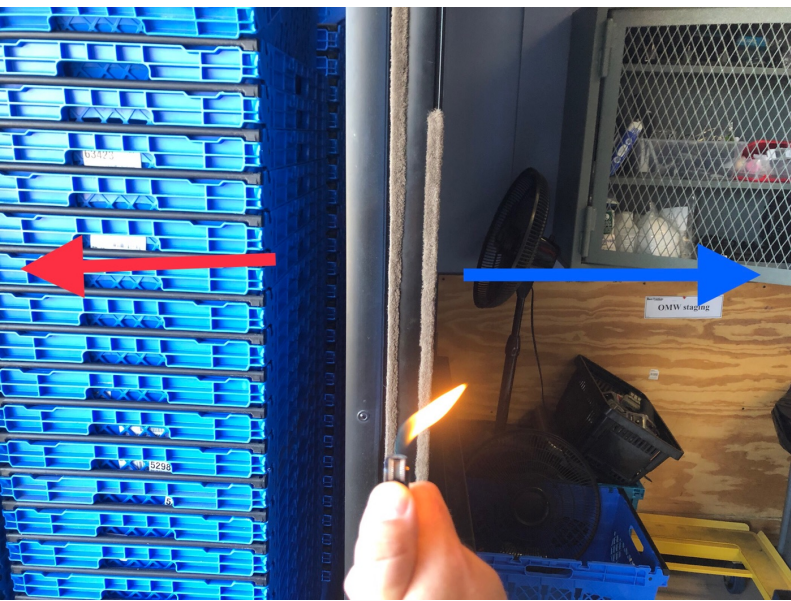

LIGHTER PLACED IN DOOR FRAME OF PICKUP AREA. RED POINTS TO OUTSIDE BLUE POINTS TO INSIDE. FLAME SHOWS THAT OUTSIDE AIR IS INFILTRATING AREA WHEN DOOR IS OPEN.

05-13-22

Date	Time	Point:
NONE	NONE	RH
05-13-22	12:48:00	67.00
05-13-22	12:45:00	66.00
05-13-22	12:42:00	54.00
05-13-22	12:39:00	59.00
05-13-22	12:36:00	57.00
05-13-22	12:33:00	57.00
05-13-22	12:30:00	57.00
05-13-22	12:27:00	57.00
05-13-22	12:24:00	58.00
05-13-22	12:21:00	58.00
05-13-22	12:18:00	58.00
05-13-22	12:15:00	58.00
05-13-22	12:12:00	55.00
05-13-22	12:09:00	57.00
05-13-22	12:06:00	56.00
05-13-22	12:03:00	56.00
05-13-22	12:00:00	55.00
05-13-22	11:57:00	55.00
05-13-22	11:54:00	56.00

Sample Number: 1 / 3360

F1: BEGINNING F2: EN

RELATIVE HUMIDITY TRENDS IN SPACE WHEN DOOR IS OPEN. DOOR OPENED AT 12:36.

05-13-22

Date	Time	Point:
NONE	NONE	DF
05-13-22	12:48:00	70.90
05-13-22	12:45:00	70.80
05-13-22	12:42:00	70.80
05-13-22	12:39:00	70.60
05-13-22	12:36:00	70.30
05-13-22	12:33:00	70.10
05-13-22	12:30:00	70.10
05-13-22	12:27:00	70.10
05-13-22	12:24:00	70.60
05-13-22	12:21:00	70.90
05-13-22	12:18:00	70.90
05-13-22	12:15:00	70.60
05-13-22	12:12:00	70.30
05-13-22	12:09:00	70.10
05-13-22	12:06:00	70.10
05-13-22	12:03:00	70.10
05-13-22	12:00:00	70.80
05-13-22	11:57:00	70.80
05-13-22	11:54:00	70.80

Sample Number: 1 / 3360

TEMPERATURE TRENDS IN SPACE WHEN DOOR IS OPENED. DOOR OPENED AT 12:36.

Date	Time	Point:
NONE	NONE	RH
05-13-22	13:30:00	58.00
05-13-22	13:27:00	58.00
05-13-22	13:24:00	59.00
05-13-22	13:21:00	59.00
05-13-22	13:18:00	59.00
05-13-22	13:15:00	59.00
05-13-22	13:12:00	59.00
05-13-22	13:09:00	58.00
05-13-22	13:06:00	58.00
05-13-22	13:03:00	59.00
05-13-22	13:00:00	61.00
05-13-22	12:57:00	62.00
05-13-22	12:54:00	62.00
05-13-22	12:51:00	56.00
05-13-22	12:48:00	67.00
05-13-22	12:45:00	66.00
05-13-22	12:42:00	54.00
05-13-22	12:39:00	59.00
05-13-22	12:36:00	57.00

Sample Number: 1 / 3360

F1: BEGINNING

F2: E

RELATIVE HUMIDITY TRENDS WHEN DOOR IS SHUT. DOOR SHUT AT 13:03.



PICKUP DOOR IS MISSING AIR CURTAIN.



DUCTWORK FOR GRILLE NEAR PICKUP AREA DOOR IS OPEN. LARGE AMOUNTS OF SUPPLY AIR FROM RTU-1 LEAKING INTO CEILING SPACE.