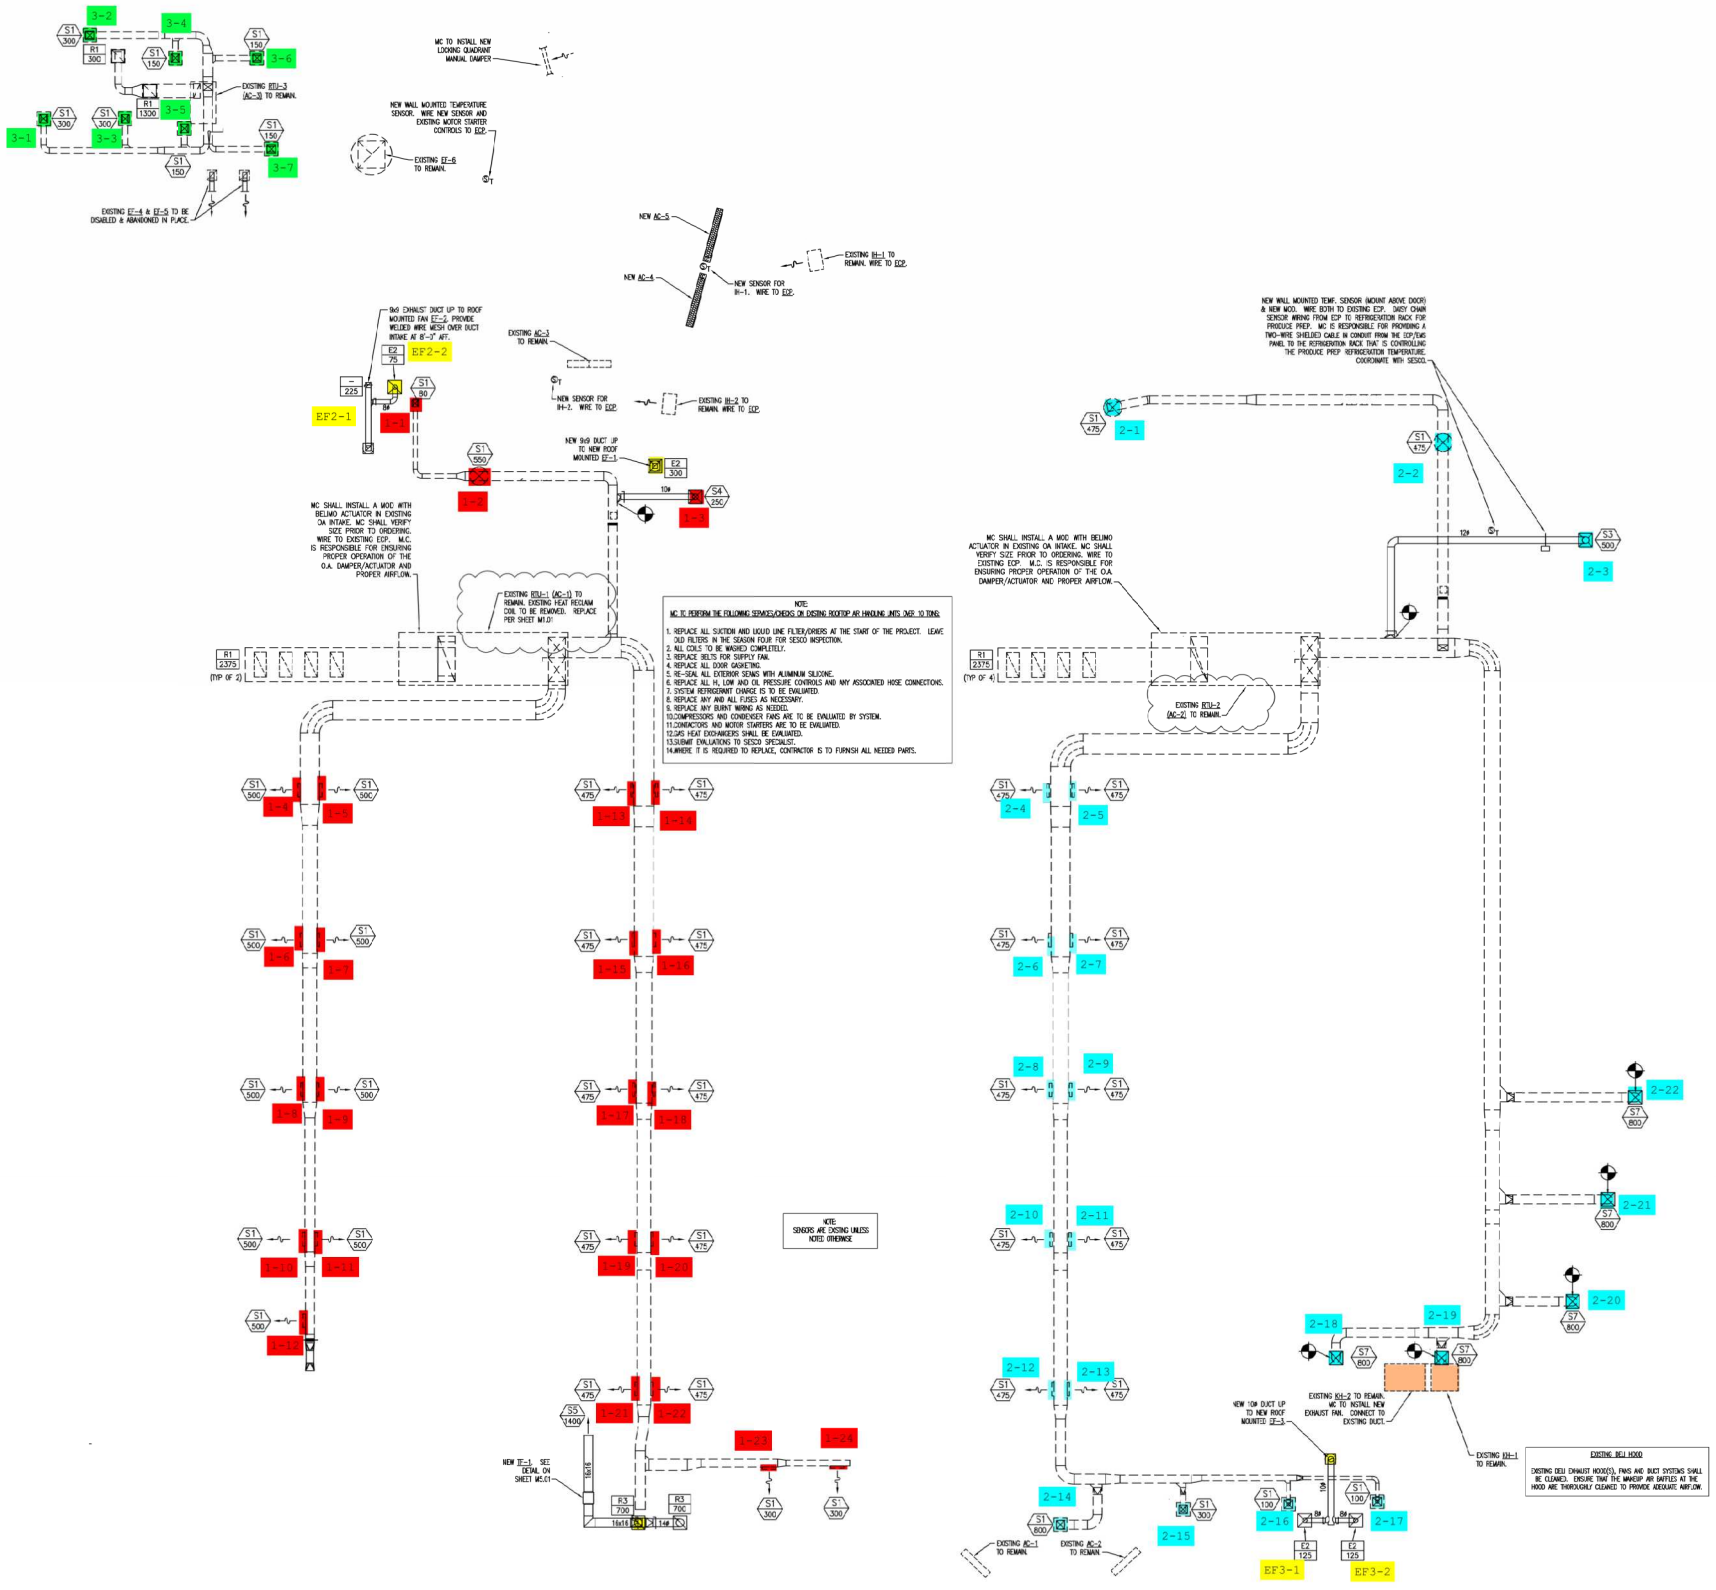

1. M.C. SHALL FIELD VERIFY A
NOTIFY FOOD LION SHARED
2. FOR TRANSVERSE JOINTS
DUCT MATE CR WARD AN
RECOMMENDATIONS. DUCT
DUCTWORK SHALL BE CO
OR SMALLER, THE ABOVE
CONSTRUCTION FOR THE
3. ALL DUCTWORK WITH A WID
TYPE HANGERS. SUPPORTS
INSULATION. INSULATION S
4. DUCTS CONNECTING TO NE
PROVIDE VOLUME DAMPER
5. ALL LONGITUDINAL SEAMS A
HIGH PRESSURE DUCT SEA
APPROVED BY FOOD LION
6. ALL NEW DUCT SIZES SHO
3/4 PCF, EXTERNALLY WRA
NEW DUCTWORK AS TIGHT
WITH OTHER TRADES.
7. FLEXIBLE DUCT MAY BE US
SMACNA STANDARDS (SEE
8. PROVIDE 90° METAL (24 GA
DIFFUSER/GRILLE-TO-FLEX
9. M.C. SHALL VERIFY SIZE OF
REQUIRED FOR PROPER CO
10. M.C. SHALL INSPECT AND R
SYSTEM. M.C. SHALL CAP
EXISTING DUCTWORK DIRECT
RETURN OUTLETS SHALL BE
11. M.C. SHALL COORDINATE AL
12. COORDINATE ALL DIFFUSER
DRAWINGS.
13. TEMPERATURE AND HUMIDIT
VERIFY MOUNTING HEIGHTS,
CONSTRUCTION MANAGER.
14. CONTROL WIRING FOR NEW
M.C. CONTROL WIRING S
E.C. SHALL PROVIDE COND
FOOD LION CONSTRUCTION
15. EXISTING MOTOR STARTER C
16. ALL SENSOR CONTROL WIR
SHALL BE STRANDED (#14
CONDUIT.
17. M.C. TO COORDINATE DUCTW
FOOD LION CONSTRUCTION
18. REFER TO SPECIFICATIONS,
19. MECHANICAL CONTRACTOR B
20. ALL EXHAUST HOODS SHALL
21. THE MECHANICAL CONTRACT
INSTALLED BY HIM UNDER T
ADJUDGED BY FOOD LION.
(12) MONTHS FROM THE DA
GROUP, L.L.C., AGAINST AN
WARRANTIES WHICH EXTEND
LION. HOWEVER, IT SHALL
PERTAIN ONLY TO FURNISHI
REPLACEMENT LABOR COST
22. ENGINEER OF RECORD TO F
23. ALL RECOVERED REFRIGERA
SUBMITTED TO NICK CORDA
RECOVERED REFRIGERANT B

① THERMOSTAT

S_T TEMPERATURE

NOTES:
1. THE E.C. IS RESPONSIBLE F
AND THE HVAC CONTROLLER
STORES THAT HAVE E-2 CO
VERSIONS OF CPC CONTROL
2. MC SHALL PROVIDE (1) PAI
RACK TO THE EXISTING AND
CONDUIT. EMS PERSONNEL
3. NEW AND/OR EXISTING SEN
AS APPLICABLE.

AHU	AIR HANDLING U
AFF	ABOVE FINISHED
20x20	NEW DUCTW FIRST DIMEN SHOWN ON F
	ELECTRIC DU
	VOLUME DAMP
	NEW SUPPLY DIFFUSE
	AIR CURTAIN –

1. ALL CONTROL WIRING PROVI
CABLE IS NOT ALLOWED. A
CONDUIT PROVIDED BY ELEC
CONTROL WIRING. TERMINAT
2. IN THE EVENT THAT FOOD L
REMOVING ALL OLD SMOKE
CONTACT, SESCO WILL NOTI
DETECTORS IS TO BE REMO
WIRING FROM ECP TERMINA

DIRECTOR	

VERSION-1.2_(RELEASED_2021_05_13)

NAME: X:\ENGIPRELIMINARY\STORES\LANSFOOD LION\2800\2823 (FORMER BILO 5221)\2823FLMF02\INCOMING DOCUMENTS\MECHANICAL\2823MN.01(REV05-09-22).DWG May 11, 2022 - 9:47am