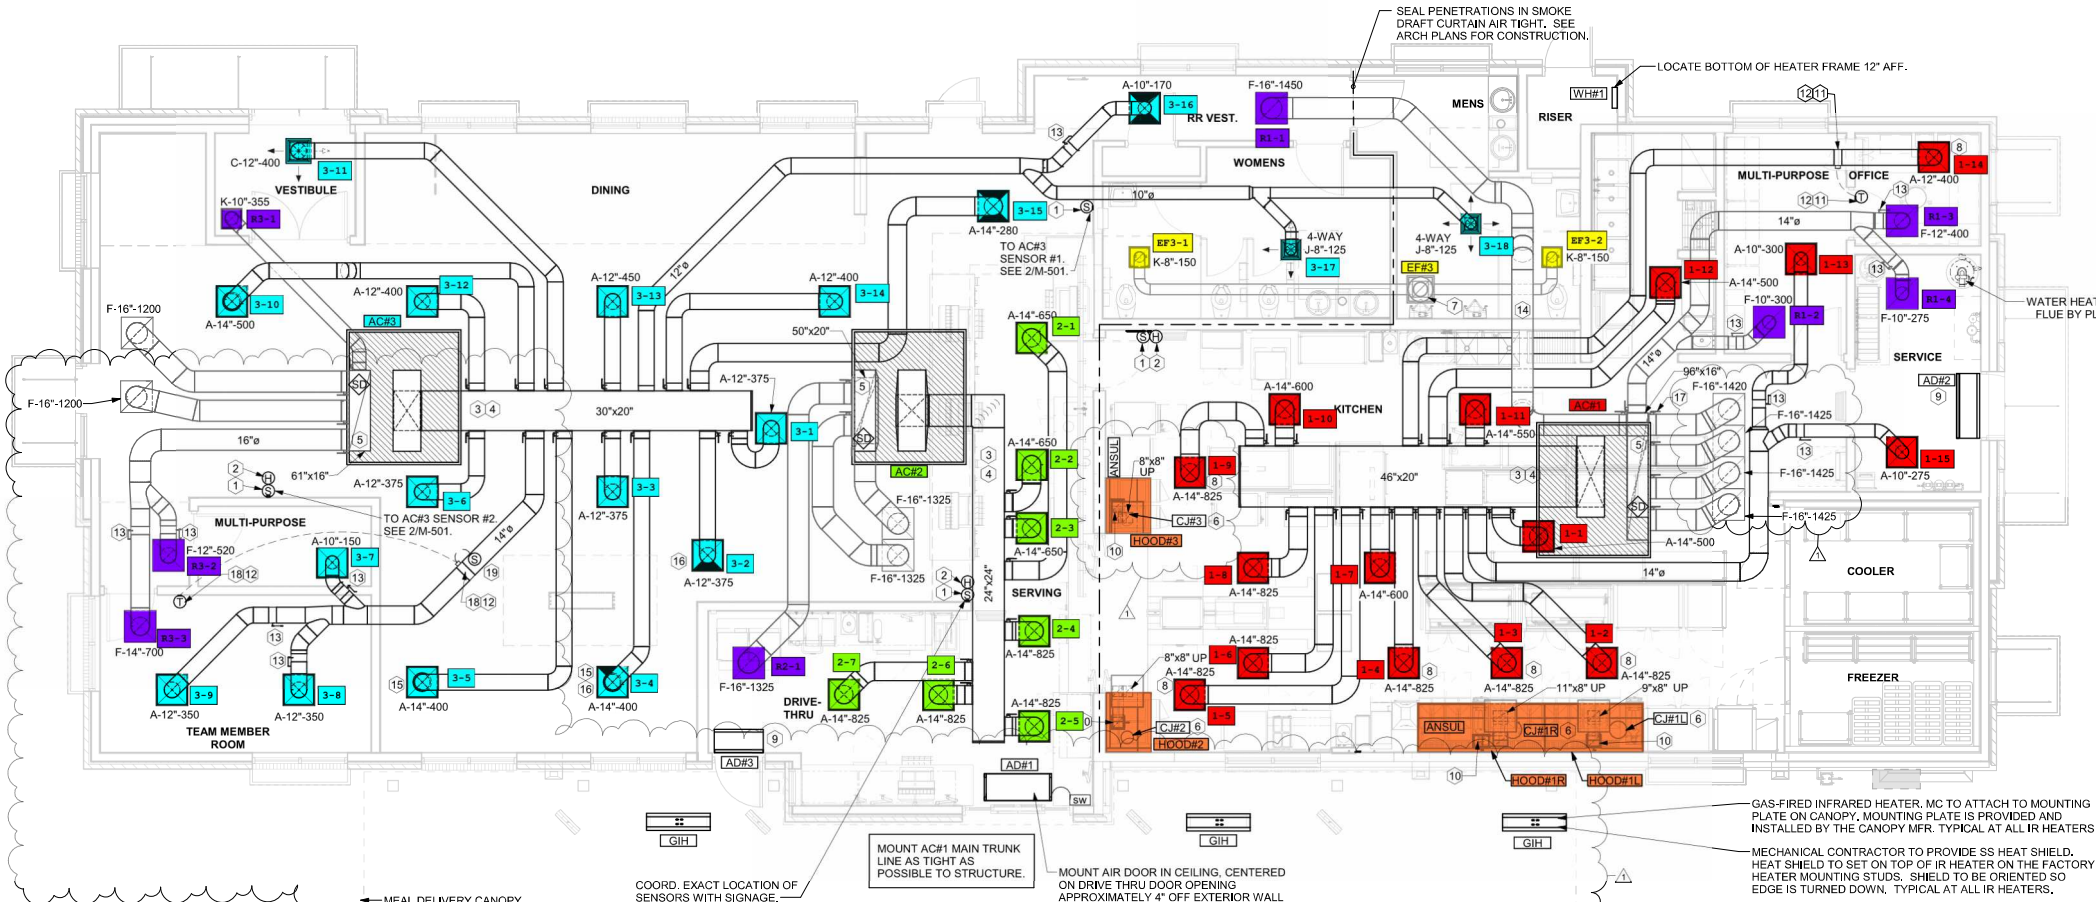
SEAL PENETRATIONS IN SMOKE DRAFT CURTAIN AIR TIGHT. SEE ARCH PLANS FOR CONSTRUCTION.
LOCATE BOTTOM OF HEATER FRAME 12" AFF.
WH#1
VESTIBULE
DINING
RR VEST.
WOMENS
MENS
RISER
MULTI-PURPOSE
OFFICE
SERVICE
KITCHEN
SERVING
DRIVE-THRU
COOLER
FREEZER
TEAM MEMBER ROOM
MULTI-PURPOSE
AC#1
AC#2
AC#3
EF#3
HOOD#1L
HOOD#1R
HOOD#2
HOOD#3
AD#1
AD#2
AD#3
GIH
SW
TO AC#3 SENSOR #1. SEE 2/M-501.
TO AC#3 SENSOR #2. SEE 2/M-501.
COORD. EXACT LOCATION OF SENSORS WITH SIGNAGE.
MOUNT AC#1 MAIN TRUNK LINE AS TIGHT AS POSSIBLE TO STRUCTURE.
MOUNT AIR DOOR IN CEILING, CENTERED ON DRIVE THRU DOOR OPENING APPROXIMATELY 4" OFF EXTERIOR WALL
GAS-FIRED INFRARED HEATER. MC TO ATTACH TO MOUNTING PLATE ON CANOPY. MOUNTING PLATE IS PROVIDED AND INSTALLED BY THE CANOPY MFR. TYPICAL AT ALL IR HEATERS
MECHANICAL CONTRACTOR TO PROVIDE SS HEAT SHIELD. HEAT SHIELD TO SET ON TOP OF IR HEATER ON THE FACTORY HEATER MOUNTING STUDS. SHIELD TO BE ORIENTED SO EDGE IS TURNED DOWN. TYPICAL AT ALL IR HEATERS.
WATER HEAT
FLUE BY PL
MEAL DELIVERY CANOPY