

Report By:

National TAB
1329 E. KEMPER ROAD
SUITE 4210
CINCINNATI, OH 45246



Report: TAB Punch-List
Function: Test, Adjust, & Balance
Date: 07/08/2025
Completed By: National TAB

PROJECT
Liberty Collective (Liberty Twp, OH)

Lakota Lane

Liberty Twp, OH 45011

Client

BACHMAN'S HVAC SOLUTIONS
4058 CLOUGH WOODS DR.

BATAVIA, OH

National TAB

Project: Liberty Collective (Liberty Twp, OH)

Table Of Contents

Section	Page #
Issue Data	3

Issue List

- BOH Hallway diffusers
- EF 1
- EFS 2 and 3
- RTU 3 Party Rooms



Liberty Collective (Liberty Twp, OH)

Project Issue Information

Issue Name : BOH Hallway diffusers
Description : BOH long hallway diffusers are above design and do not have dampers installed. This is causing the vendor spaces to be low on flow. There is limited space (~4") between the bottom of the main duct and the diffuser. It is unlikely to install an inline damper between the bottom of the duct and the diffusers. Face dampers may be needed.

Created By : National TAB **Assigned To :** National TAB - Nick Payne
Status : Open
Priority : [Medium](#) **Asset Tag :**
Originated Date : 09/09/2025 - Gabe Merk - National TAB



Liberty Collective (Liberty Twp, OH)

Project Issue Information

Issue Name : EF 1
Description : EF 1 is above design airflow: 2308/1600 cfm and is not accessible via traditional means. Unable to get an extension ladder tall enough up by RTU 3 to access EF 1 to make adjustments.
Created By : National TAB **Assigned To :** National TAB - Nick Payne
Status : Open
Priority : Medium **Asset Tag :**
Originated Date : 09/09/2025 - Gabe Merk - National TAB




Liberty Collective (Liberty Twp, OH)

Project Issue Information

Issue Name : EFS 2 and 3
Description : EFS 2 and 3 are single speed and are both pulling 2.5x design flow. Unable to reduce flow to design.
Created By : National TAB **Assigned To :** National TAB - Nick Payne
Status : Open
Priority : **Medium** **Asset Tag :**
Originated Date : 07/09/2025 - Gabe Merk - National TAB

Project Issue File Details

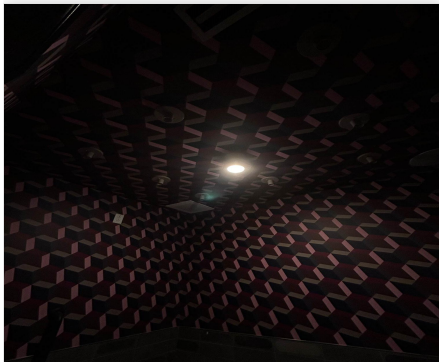

07/09/2025



Liberty Collective (Liberty Twp, OH)

Project Issue Information

Issue Name : RTU 3 Party Rooms
Description : Low flow in party rooms. Unable to access dampers in party rooms to determine whether or not they are fully open. Party room airflow increases with door open. Tight construction may be preventing flow. No transfer air called for on prints.
Created By : National TAB **Assigned To :** National TAB - Nick Payne
Status : Open
Priority : Medium **Asset Tag :**
Originated Date : 07/08/2025 - Gabe Merk - National TAB