

PlanGrid Task Report - Jan 29, 2025

Prepared by Will T

Jan 29, 2025

Description

7 tasks in this report.

Contents

#41 [SITE 500] [NEW] TAB is complete.	2
#40 [CNTL 999] [NEW] (MISC) AC3 humidity sensor not responding	3
#39 [UNIT 999] [NEW] (MISC) AC4 FroStat Tripped Alarm	6
#38 [REFG 505] [NEW] WIC door sweep vs threshold.....	8
#36 [HOOD 512] [NEW] Fry chute.	11
#29 [CNTL 508] [NEW] Controls labeling.....	12
#22 [UNIT 517] [NEW] Condensate piping construction.....	16

#41 [SITE 500] [NEW] TAB is complete.

Status

Open

Start Date

Nov 21, 2024

Type

Planned Work

Created

Nov 21, 2024 3:29 PM
jacobd@nationaltab.com

List

TAB Punch List

Last Updated

Jan 29, 2025 3:59 PM

Description

TAB is complete with only non-critical tasks open.

#40 [CNTL 999] [NEW] (MISC) AC3 humidity sensor not responding

Status

Open

Start Date

Nov 21, 2024

Type

Planned Work

Created

Nov 21, 2024 12:09 PM
jacobd@nationaltab.com

List

TAB Punch List

Last Updated

Jan 29, 2025 3:59 PM

Description

AC3 has two active alarms for "OUTDOOR AIR ENTHALPY ACTIVE" and "OUTDOOR AIR RELATIVE HUMIDITY LOCAL" and it appears to be interfering with humidity readings on the thermostat.

Comments

Provide screenshot of Symbio app showing no alarms to close.

Will T Jan 29, 2025

Photos



IMG_7194

Kenneth Podgorsek

Dec 4, 2024 12:55 PM



IMG_7196

Kenneth Podgorsek

Dec 4, 2024 12:54 PM



IMG_0067

Jacob Davidson

Nov 21, 2024 12:10 PM



IMG_0051

Jacob Davidson

Nov 21, 2024 12:10 PM

#39 [UNIT 999] [NEW] (MISC) AC4 FroStat Tripped Alarm

Status

Open

Start Date

Nov 21, 2024

Type

Planned Work

Created

Nov 21, 2024 12:06 PM
jacobd@nationaltab.com

List

TAB Punch List

Last Updated

Jan 29, 2025 4:00 PM

Description


AC4 has an active alarm "FROSTAT TRIP" and it is preventing the condensers from turning on during cooling. Tech tried to put unit into test cooling and while fan speed increase, the condensers did not turn on.

Comments

Provide picture of TRANE display screen with no alarms to close. Attached picture is of incorrect display/unit.

Will T Jan 29, 2025

Photos

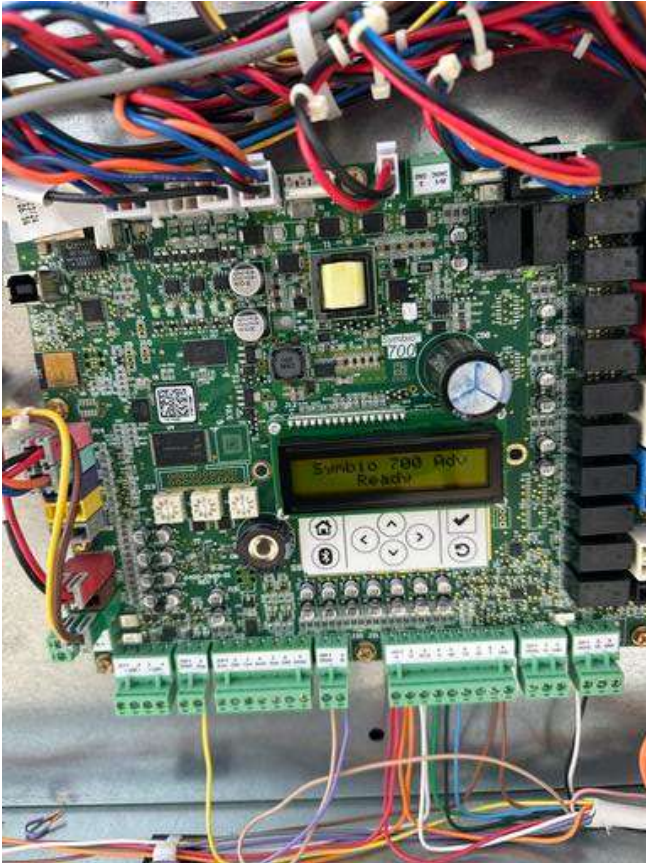

IMG_7197

Kenneth Podgorsek

Dec 4, 2024 12:55 PM



IMG_0054

Jacob Davidson

Nov 21, 2024 12:10 PM



IMG_0059

Jacob Davidson

Nov 21, 2024 12:10 PM

#38 [REFG 505] [NEW] WIC door sweep vs threshold.

Status

Open

Start Date

Nov 21, 2024

Type

Planned Work

Created

Nov 21, 2024 12:01 PM
jacobd@nationaltab.com

List

TAB Punch List

Last Updated

Nov 21, 2024 1:12 PM

Description

WIC door sweep is not sealed tightly with threshold when door is closed. Only translucent light should be present inspecting from the inside out with box lights off.

Comments

Cooler tech lowered the door down as far as it will go but there are gaps in the tile where light can still be seen. To alleviate this, a threshold will need to be added.

Jacob Davidson Nov 21, 2024

Photos



IMG_4130

Jacob Davidson

Nov 21, 2024 1:12 PM



IMG_4134

Jacob Davidson

Nov 21, 2024 1:12 PM

L05075_Cedarbrook Plaza (Wyncote, PA) FSU

3001 West Cheltenham Avenue, Wyncote, Pennsylvania


L1020005075



IMG_4132
Jacob Davidson
Nov 21, 2024 1:12 PM



IMG_4131
Jacob Davidson
Nov 21, 2024 1:12 PM

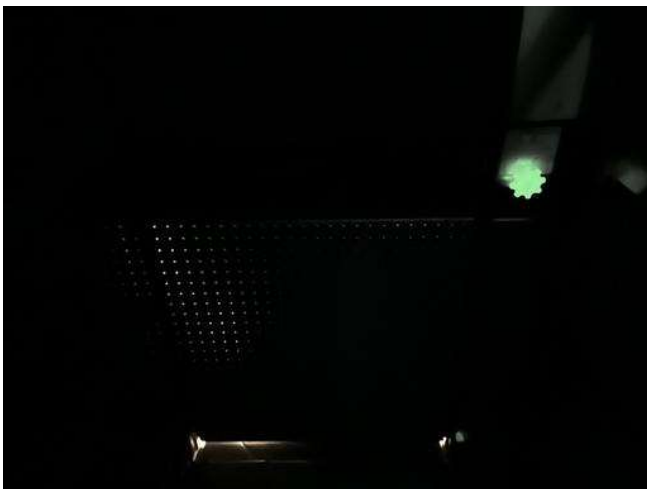

IMG_0056
Jacob Davidson
Nov 21, 2024 12:10 PM

#36 [HOOD 512] [NEW] Fry chute.

Status

Open

Start Date

Nov 21, 2024

Type

Planned Work

Created

Nov 21, 2024 11:59 AM
jacobd@nationaltab.com

List

TAB Punch List

Last Updated

Jan 29, 2025 4:01 PM

Description

HD2 and HD3 are missing its fry chute.

Comments

Provide documentation to close task.

Will T Jan 29, 2025

Photos



IMG_0070

Jacob Davidson

Nov 21, 2024 12:11 PM



IMG_0069

Jacob Davidson

Nov 21, 2024 12:11 PM

#29 [CNTL 508] [NEW] Controls labeling.

Status

Open

Start Date

Nov 19, 2024

Sheet

M-701

Type

Planned Work

Created

Nov 19, 2024 10:31 AM
jacobd@nationaltab.com

List


TAB Punch List

Last Updated

Jan 29, 2025 4:01 PM

Description

Label all sensors, humidistats, thermostats, smoke annunciators and remote space mounted OADs, MODs, VFD's for which piece of equipment they serve. Most are labeled but some are not.

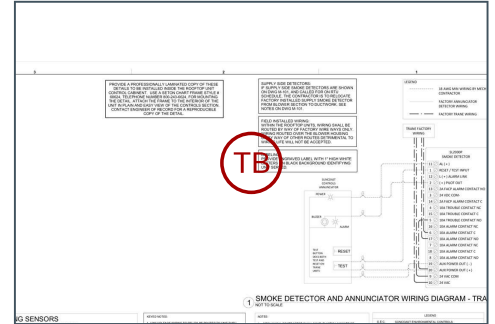

Comments

Labels not worded per plan. Recommend replacing or seeking approval as-is from CFA CM.

Will T Jan 29, 2025

Photos



20241203_112844_photo

Kenneth Podgorsek

Dec 3, 2024 11:28 AM



20241203_112831_photo

Kenneth Podgorsek

Dec 3, 2024 11:28 AM



IMG_9980

Jacob Davidson

Nov 19, 2024 10:34 AM



IMG_9976

Jacob Davidson

Nov 19, 2024 10:34 AM



IMG_9977

Jacob Davidson

Nov 19, 2024 10:34 AM



IMG_9975

Jacob Davidson

Nov 19, 2024 10:34 AM



IMG_9981

Jacob Davidson

Nov 19, 2024 10:34 AM



IMG_9982

Jacob Davidson

Nov 19, 2024 10:34 AM

L05075_Cedarbrook Plaza (Wyncote, PA) FSU

3001 West Cheltenham Avenue, Wyncote, Pennsylvania

L1020005075



IMG_9991

Jacob Davidson

Nov 19, 2024 10:19 AM



IMG_9990

Jacob Davidson

Nov 19, 2024 10:19 AM



IMG_9989

Jacob Davidson

Nov 19, 2024 10:19 AM



IMG_9988

Jacob Davidson

Nov 19, 2024 10:19 AM