

Issue List

- NONFUNCTIONAL/INACCESSIBLE DAMPERS
- RIGID DUCT NOT INSTALLED



03-02-26 CULVERS - MESA, AZ

Project Issue Information

Issue Name : NONFUNCTIONAL/INACCESSIBLE DAMPERS
Description : SGRD1-7: Flow varies between 345-380cfm regardless of lever movement (DR). Some dampers are covered by insulation and the cable tie.
Created By : National TAB **Assigned To :** National TAB - Brianna Biggs
Status : Open
Priority : Urgent **Asset Tag :** SGRD7
Originated Date : 03/06/2026 - Christine Weale - National TAB




03-02-26 CULVERS - MESA, AZ

Project Issue Information

Issue Name : RIGID DUCT NOT INSTALLED
Description : MSET details cookline duct flex to come from a rigid straight pipe. Duct is flex only on some branches and is not straight. Recommend installing straight pipe from main supply drop and duct coming down straight, not curvy, so no smoke issues arise in kitchen and flow balances properly.
Created By : National TAB **Assigned To :** National TAB - Brianna Biggs
Status : Open
Priority : High **Asset Tag :** RTU-2
Originated Date : 03/05/2026 - Christine Weale - National TAB

Project Issue File Details

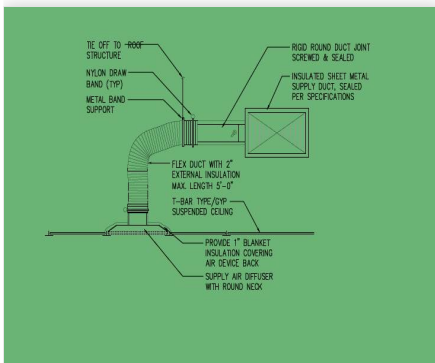

03/05/2026

WHITE LAMINATE NAMEPLATE WITH 2" LETTERS VISIBLE ADJACENT TO DISCONNECT SWITCH FOR HVAC UNITS AND FANS.

ANY FLEXIBLE DUCTS SHALL BE INSTALLED IN CONCEALED SPACES ONLY. THE MAXIMUM ALLOWABLE LENGTH OF FLEXIBLE DUCT SHALL BE 5'-0". ALL FLEXIBLE DUCTS SHALL BE CONNECTED TO BRANCH RUNS AND FITTINGS WITH A PANDUIT-TYPE BAND, AND SHALL NOT BE ATTACHED DIRECTLY TO THE AIR DEVICE COLLAR.

SUPPLY, RETURN, RESTROOM EXHAUST DUCT CONSTRUCTION SHALL BE

03/06/2026



03/05/2026