

TAB Punchlist

Prepared by Tyler Youells

Jul 2, 2025

Description

7 tasks in this report.

Contents

#29 [EXHA 999] [NEW] (MISC) Grease cleanout.....	2
#28 [HOOD 508] [NEW] Sidejet arm angle bracket.	3
#26 [UNIT 504] [NEW] Equipment Fresh Air Tempering.	5
#24 [UNIT 517] [NEW] Condensate piping construction.	7
#23 [UNIT 523] [NEW] Trane powered exhaust.	8
#19 [REFG 516] [NEW] Condenser electrical disconnects.	10
#18 [REFG 999] [NEW] (MISC) WIF Thermometer	11

#29 [EXHA 999] [NEW] (MISC) Grease cleanout

Status
Open

Start Date
Jun 30, 2025

Sheet
MH-1.5

Type
Planned Work


Created
Jun 30, 2025 11:22 AM
tyouells@nationaltab.com

List
5.1 TAB Punchlist

Last Updated
Jun 30, 2025 11:38 AM

Description

EF-2 needs another Greas cleanout installed on the Runout for HD-2. Specd is two cleanout in the run only one is cut-in and installed.

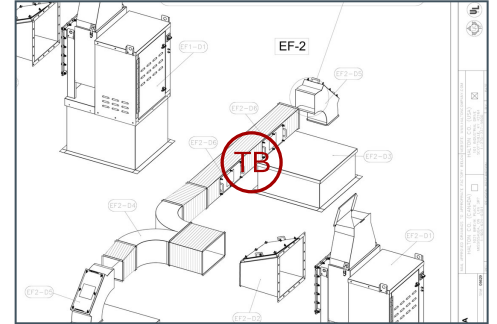

Photos



IMG_2630
Tyler Youells
Jun 30, 2025 11:38 AM

#28 [HOOD 508] [NEW] Sidejet arm angle bracket.

Status

Open

Start Date

Jun 30, 2025

Sheet

MH-1.2

Type

Planned Work

Created

Jun 30, 2025 11:22 AM
tyouells@nationaltab.com

List


5.1 TAB Punchlist

Last Updated

Jun 30, 2025 11:38 AM

Description

(HD-2)The Halton supplied angle bracket that connects the integral sidejet arm to the counter is missing or not installed correctly. Secure bracket to arm and bracket to counter underneath removeable fry dump via stainless steel rivets.

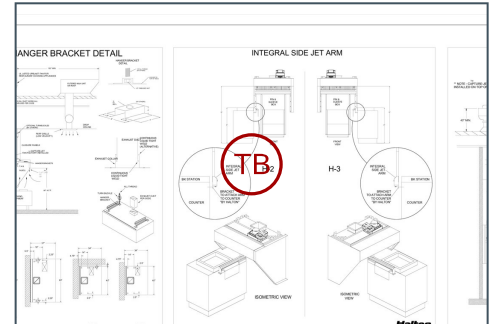

Photos

L05629_Langhorne (PA) FSU

1440 Lincoln Highway, Langhorne, Pennsylvania

L01020005629



IMG_2634

Tyler Youells

Jun 30, 2025 11:38 AM

L05629_Langhorne (PA) FSU

1440 Lincoln Highway, Langhorne, Pennsylvania

L01020005629

#26 [UNIT 504] [NEW] Equipment Fresh Air Tempering.

Status

Open

Start Date

Jun 30, 2025

Sheet

M-701

Type

Planned Work

Created

Jun 30, 2025 11:22 AM
tyouells@nationaltab.com

List

5.1 TAB Punchlist


Last Updated

Jun 30, 2025 11:43 AM

Description

104 Timers are not functioning correctly. It was observed Heating turns on immediately after cooling stops and runs for approximately 1 min before turning off

Photos

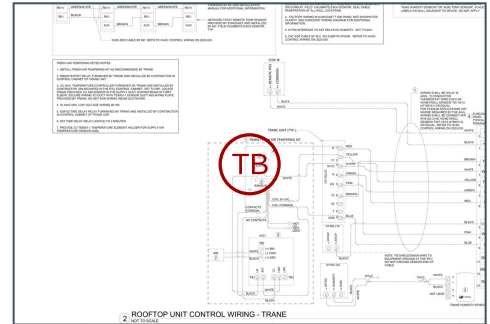

L05629_Langhorne (PA) FSU

1440 Lincoln Highway, Langhorne, Pennsylvania

L01020005629



IMG_2650

Tyler Youells

Jun 30, 2025 11:43 AM

#24 [UNIT 517] [NEW] Condensate piping construction.

Status
Open

Start Date
Jun 30, 2025

Sheet
M-102

Type
Planned Work


Created
Jun 30, 2025 11:22 AM
tyouells@nationaltab.com

List
5.1 TAB Punchlist

Last Updated
Jun 30, 2025 11:40 AM

Description

Equipment condensate piping Roof routing does not match prints.

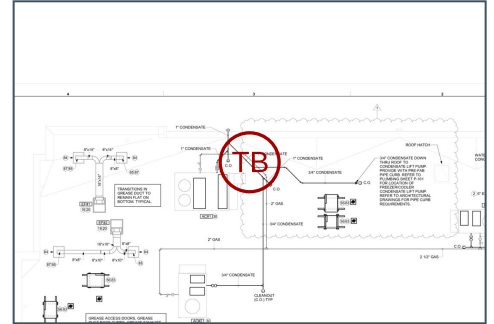

Photos



IMG_2623
Tyler Youells
Jun 30, 2025 11:39 AM



IMG_2624
Tyler Youells
Jun 30, 2025 11:39 AM

L05629_Langhorne (PA) FSU

1440 Lincoln Highway, Langhorne, Pennsylvania

L01020005629

#23 [UNIT 523] [NEW] Trane powered exhaust.

Status

Open

Start Date

Jun 30, 2025

Sheet

M-102

Type

Planned Work

Created

Jun 30, 2025 11:22 AM
tyouells@nationaltab.com

List

5.1 TAB Punchlist

Last Updated

Jul 2, 2025 2:29 PM

Description

AC-3 Powered Exhaust fan wheel does not spin freely and rubs.

Comments


MC has adjusted the fan wheel and now spins freely.

Tyler Youells Jul 2, 2025

Item Reopened, Powered exhaust fan is rubbing again\

Tyler Youells Jul 2, 2025

Photos

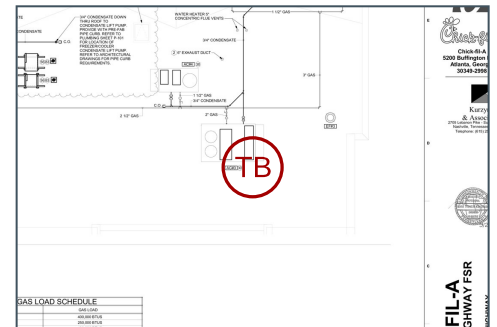

L05629_Langhorne (PA) FSU

1440 Lincoln Highway, Langhorne, Pennsylvania

L01020005629



IMG_2619

Tyler Youells

Jun 30, 2025 11:40 AM

L05629_Langhorne (PA) FSU

1440 Lincoln Highway, Langhorne, Pennsylvania

L01020005629

#18 [REFG 999] [NEW] (MISC) WIF Thermometer

Status

Open

Start Date

Jun 30, 2025

Sheet

M-101

Type

Planned Work

Created

Jun 30, 2025 11:22 AM
tyouells@nationaltab.com

List


5.1 TAB Punchlist

Last Updated

Jun 30, 2025 11:41 AM

Description

WIF Thermometer is not reading true to the Freezer Temp, Inside was 2F and thermometer is reading -15F

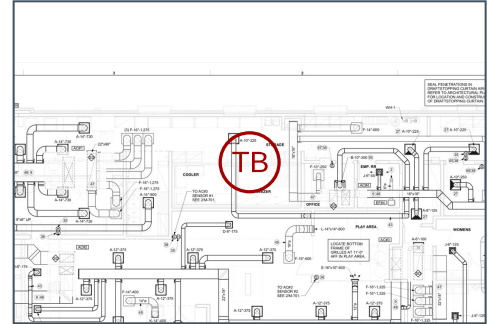

Photos


L05629_Langhorne (PA) FSU

1440 Lincoln Highway, Langhorne, Pennsylvania

L01020005629



IMG_2645
Tyler Youells
Jun 30, 2025 11:41 AM

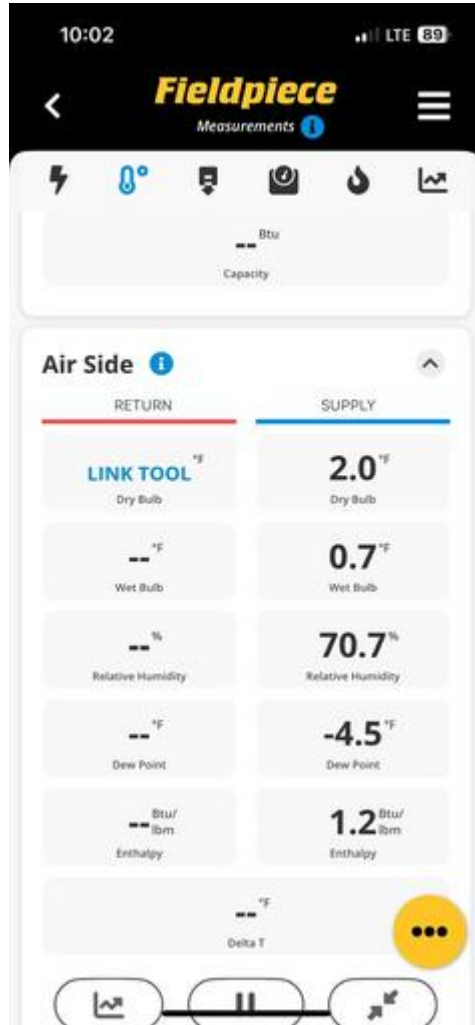

IMG_2646
Tyler Youells
Jun 30, 2025 11:41 AM