

## Issue List

- 1 INCORRECT GRILLE - KITCHEN
- CONDENSER DRAIN IN THE WAY OF DOOR
- EF1 NO SPEED CONTROLLER
- INACCESSIBLE DAMPER



**02-09-26 QT #0489 CASA GRANDE, AZ**

**Project Issue Information**

**Issue Name :** 1 INCORRECT GRILLE - KITCHEN  
**Description :** Wrong grille, can't be adjusted. The other 3 are correct.  
**Created By :** National TAB                      **Assigned To :** National TAB - Dan Hertenstein  
**Status :** Open  
**Priority :** Low                                      **Asset Tag :** SGRD1  
**Originated Date :** 02/13/2026 - Christine Weale - National TAB

Project Issue File Details



02/13/2026



02-09-26 QT #0489 CASA GRANDE, AZ

**Project Issue Information**

**Issue Name :** CONDENSER DRAIN IN THE WAY OF DOOR  
**Description :** The door to the mixed air compartment cannot be opened very far, due to the drain being in the way. The economizer control could barely be reached. Recommend adjusting drain to allow full access.  
**Created By :** National TAB                      **Assigned To :** National TAB - Dan Hertenstein  
**Status :** Open  
**Priority :** Low                                      **Asset Tag :** RT-3  
**Originated Date :** 02/13/2026 - Christine Weale - National TAB

Project Issue File Details



02/13/2026



02/13/2026




02-09-26 QT #0489 CASA GRANDE, AZ


**Project Issue Information**

**Issue Name :** EF1 NO SPEED CONTROLLER  
**Description :** When I arrived, EF1 was improperly wired and not running, I fixed it, but it was running way too high so I disconnected the fan for safety. There should be a safety disconnect switch and a speed control. Possible fan speed may also be controlled via wiring. No disconnect switch, so power unplugged at the motor connector.  
**Created By :** National TAB                      **Assigned To :** National TAB - Dan Hertenstein  
**Status :** Open  
**Priority :** Urgent                                      **Asset Tag :** EF1  
**Originated Date :** 02/13/2026 - Christine Weale - National TAB

Project Issue File Details

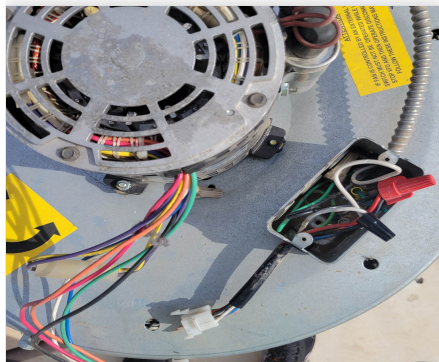

02/13/2026

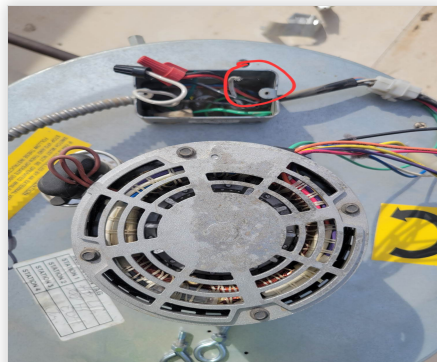

02/13/2026



**02-09-26 QT #0489 CASA GRANDE, AZ**

**Project Issue Information**

**Issue Name :** INACCESSIBLE DAMPER  
**Description :** Tile cannot be lifted to access damper for high flow duct SGRD3-2. Most other ducts are even to each other so just #2 needs to be closed to increase #6. Flow is high enough in other areas this shouldn't cause an issue.  
**Created By :** National TAB                      **Assigned To :** National TAB - Dan Hertenstein  
**Status :** Open  
**Priority :** Low                                      **Asset Tag :** SGRD2  
**Originated Date :** 02/13/2026 - Christine Weale - National TAB