

Issue List

- 1 INCORRECT GRILLE - KITCHEN
- CONDENSER DRAIN IN THE WAY OF DOOR
- EF1 NO SPEED CONTROLLER
- INACCESSIBLE DAMPER



02-09-26 QT #0489 CASA GRANDE, AZ

Project Issue Information

Issue Name : 1 INCORRECT GRILLE - KITCHEN
Description : Wrong grille, can't be adjusted. The other 3 are correct.
Created By : National TAB **Assigned To :** National TAB - Dan Hertenstein
Status : Open
Priority : Low **Asset Tag :** SGRD1
Originated Date : 02/13/2026 - Christine Weale - National TAB

Project Issue File Details





02-09-26 QT #0489 CASA GRANDE, AZ

Project Issue Information

Issue Name : CONDENSER DRAIN IN THE WAY OF DOOR
Description : The door to the mixed air compartment cannot be opened very far, due to the drain being in the way. The economizer control could barely be reached. Recommend cutting the pipe down, it doesn't need to be that tall anyway.
Created By : National TAB **Assigned To :** National TAB - Dan Hertenstein
Status : Open
Priority : Low **Asset Tag :** RT-3
Originated Date : 02/13/2026 - Christine Weale - National TAB

Project Issue File Details



02/13/2026



02/13/2026




02-09-26 QT #0489 CASA GRANDE, AZ


Project Issue Information

Issue Name : EF1 NO SPEED CONTROLLER
Description : When I arrived, EF1 was improperly wired and not running, I fixed it, but it was running way too high so I disconnected the fan for safety. There should be a safety disconnect switch and a speed control. There isn't, so it's unplugged at the motor connector.
Created By : National TAB **Assigned To :** National TAB - Dan Hertenstein
Status : Open
Priority : Urgent **Asset Tag :** EF1
Originated Date : 02/13/2026 - Christine Weale - National TAB

Project Issue File Details

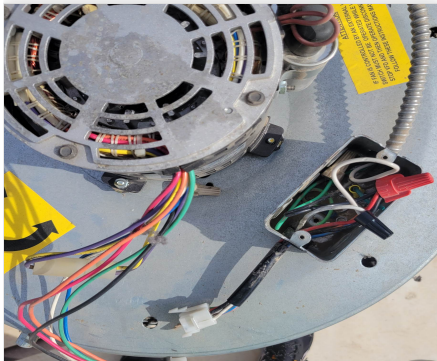

02/13/2026

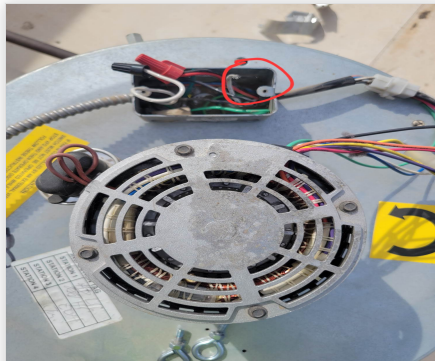

02/13/2026



02-09-26 QT #0489 CASA GRANDE, AZ

Project Issue Information

Issue Name : INACCESSIBLE DAMPER
Description : Tile cannot be lifted to access damper for high flow duct SGRD3-2. Most other ducts are even to each other so just #2 needs to be closed to increase #6. Flow is high enough in other areas this shouldn't cause an issue.
Created By : National TAB **Assigned To :** National TAB - Dan Hertenstein
Status : Open
Priority : Low **Asset Tag :** SGRD2
Originated Date : 02/13/2026 - Christine Weale - National TAB