

# PlanGrid Task Report - Sep 6, 2024

Prepared by Ian Fuller

Sep 6, 2024

## Description

14 tasks in this report.

## Contents

#368 [UNIT 039] CRITICAL (MISC) – AC#5 pulleys are not aligned .....	2
#367 [UNIT 039] CRITICAL (MISC) – AC#3 Prodigy Board is not functional.....	3
#366 [CNTL 087] CRITICAL (MISC) – Thermostat not installed .....	4
#365 [CNTL 093] Wire / cable management. ....	5
#364 [CNTL 103] UNOCC Override sequence. ....	6
#363 [CNTL 107] (MISC) Units are not wired for occupancy .....	7
#362 [EXHA 118] Restroom fan is missing birdscreen.....	8
#361 [EXHA 120] Exhaust fan spare belt. ....	8
#360 [EXHA 123] Exhaust fan discharge nozzle.....	9
#359 [EXHA 128] Grease exhaust duct curb cap.....	10
#358 [HOOD 141] CaptureJet piping. ....	11
#357 [UNIT 167] Condensate piping construction.....	12
#356 [UNIT 172] Filters to be changed. ....	14
#355 [UNIT 173] (MISC) AC#5 alarm.....	15

## #368 [UNIT 039] CRITICAL (MISC) – AC#5 pulleys are not aligned

**Status**

Open

**Start Date**

Aug 20, 2024

**Type**

Planned Work

**Created**

Aug 22, 2024 3:51 PM  
ianf@nationaltab.com

**Description**

Unable to move motor sheave into correct position to align pulleys.

**Last Updated**

Aug 22, 2024 4:59 PM

**Photos**



IMG\_8161

Ian Fuller

Aug 22, 2024 4:59 PM

## #367 [UNIT 039] CRITICAL (MISC) – AC#3 Prodigy Board is not functional

**Status**

Open

**Start Date**

Aug 22, 2024

**Type**

Planned Work

**Created**

Aug 22, 2024 3:51 PM  
ianf@nationaltab.com

**Description**

Unable to set outside air or change any setting on unit. Replacement Prodigy Board has been ordered.

**Last Updated**

Aug 22, 2024 4:59 PM

**Photos**



IMG\_8146

Ian Fuller

Aug 22, 2024 4:59 PM

## #366 [CNTL 087] CRITICAL (MISC) – Thermostat not installed

**Status**

Open

**Start Date**

Aug 22, 2024

**Type**

Planned Work

**Created**

Aug 22, 2024 3:51 PM  
ianf@nationaltab.com

**Description**

Thermostat not installed in location as shown on GRD for AC#3. Unable to locate thermostat

**Last Updated**

Aug 22, 2024 5:00 PM

**Photos**



IMG\_8182  
Ian Fuller  
Aug 22, 2024 5:00 PM



IMG\_8192  
Ian Fuller  
Aug 22, 2024 5:00 PM

## #365 [CNTL 093] Wire / cable management.

**Status**

Open

**Start Date**

Aug 20, 2024

**Type**

Planned Work

**Created**

Aug 22, 2024 3:51 PM  
ianf@nationaltab.com

**Description**

Wiring does not use correct cable management and is at extra risk of damage (beam clamps+bridal rings, wire loops for future service, runs perpendicular or parallel to structure supports).

**Last Updated**

Aug 22, 2024 5:00 PM

**Photos**



IMG\_8180  
Ian Fuller  
Aug 22, 2024 5:00 PM

---

### #364 [CNTL 103] UNOCC Override sequence.

<b>Status</b>	<b>Start Date</b>
Open	Aug 20, 2024
<b>Type</b>	<b>Created</b>
Planned Work	Aug 22, 2024 3:51 PM ianf@nationaltab.com
<b>Description</b>	<b>Last Updated</b>
Override buttons do not energize proper sequence for area during store unoccupied mode. Units do not go into auto mode when store is unoccupied.	Aug 22, 2024 3:51 PM

---

## #363 [CNTL 107] (MISC) Units are not wired for occupancy

**Status**

Open

**Start Date**

Aug 20, 2024

**Type**

Planned Work

**Created**

Aug 22, 2024 3:51 PM  
ianf@nationaltab.com


**Description**

Units are currently not wired for occupancy. Jumper between P1 and R with occupancy wire ran from P.

**Last Updated**

Aug 22, 2024 5:01 PM

### Photos

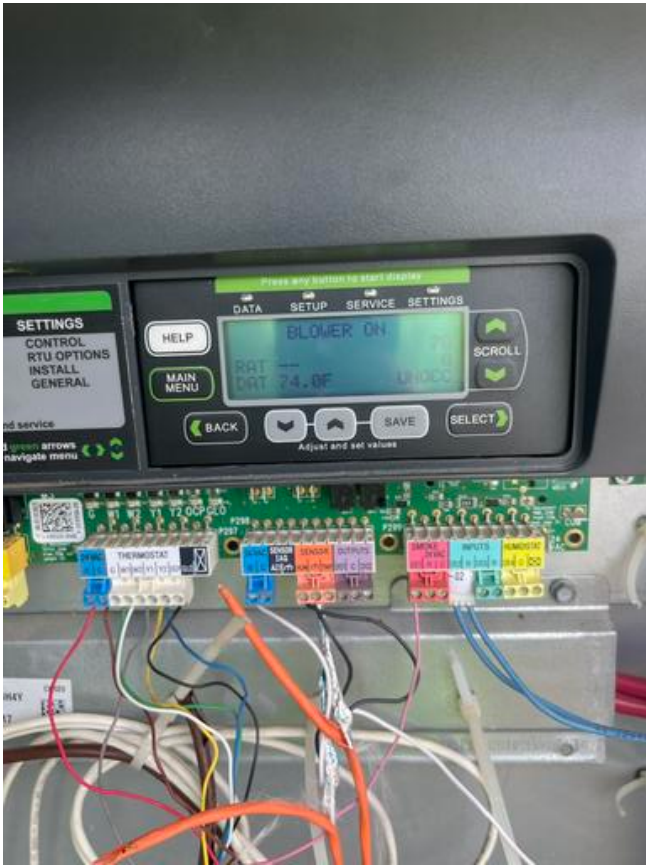

IMG\_8141

Ian Fuller

Aug 22, 2024 5:01 PM

### #362 [EXHA 118] Restroom fan is missing birdscreen.

<b>Status</b> Open	<b>Start Date</b> Aug 20, 2024
<b>Type</b> Planned Work	<b>Created</b> Aug 22, 2024 3:51 PM ianf@nationaltab.com
<b>Description</b> Restroom exhaust fan is to have birdscreen installed per non-grease exhaust fan detail.	<b>Last Updated</b> Aug 22, 2024 3:51 PM

---

### #361 [EXHA 120] Exhaust fan spare belt.

<b>Status</b> Open	<b>Start Date</b> Aug 20, 2024
<b>Type</b> Planned Work	<b>Created</b> Aug 22, 2024 3:51 PM ianf@nationaltab.com
<b>Description</b> Exhaust fan does not have factory provided spare belt on EF#2.	<b>Last Updated</b> Aug 22, 2024 3:51 PM

---

## #360 [EXHA 123] Exhaust fan discharge nozzle.

**Status**

Open

**Start Date**

Aug 20, 2024

**Type**

Planned Work

**Created**

Aug 22, 2024 3:51 PM  
ianf@nationaltab.com

**Description**

Exhaust fan discharge nozzle is not welded to discharge flange.

**Last Updated**

Aug 22, 2024 5:01 PM

**Photos**



IMG\_8167

Ian Fuller

Aug 22, 2024 5:01 PM

---

## #359 [EXHA 128] Grease exhaust duct curb cap.

**Status**

Open

**Start Date**

Aug 20, 2024

**Type**

Planned Work

**Created**

Aug 22, 2024 3:51 PM  
ianf@nationaltab.com

**Description**

Grease duct curb cap is to be screwed at all corners along with a full perimeter weld between curb cap and duct.

**Last Updated**

Aug 22, 2024 5:02 PM

**Photos**



IMG\_8169

Ian Fuller

Aug 22, 2024 5:01 PM

## #358 [HOOD 141] CaptureJet piping.

**Status**

Open

**Start Date**

Aug 22, 2024

**Type**

Planned Work

**Created**

Aug 22, 2024 3:51 PM  
ianf@nationaltab.com

**Description**

CaptureJet duct is to be hard piped and sealed at seams up to intake grilles. Intake grilles are to remain unobstructed and removable by Operator for cleaning.

**Last Updated**

Aug 22, 2024 5:02 PM

**Photos**



IMG\_8191

Ian Fuller

Aug 22, 2024 5:02 PM

## #357 [UNIT 167] Condensate piping construction.

**Status**

Open

**Start Date**

Aug 20, 2024

**Type**

Planned Work

**Created**

Aug 22, 2024 3:51 PM  
ianf@nationaltab.com

**Description**

Equipment condensate piping or p-trap is not constructed per normal CFA specifications. Union needs to be installed on both sides of P-trap. AC#1 P Trap does not have 2" difference in P-trap height.

**Last Updated**

Aug 22, 2024 5:02 PM

**Photos**



IMG\_8145  
**Ian Fuller**  
Aug 22, 2024 5:02 PM



IMG\_8138  
**Ian Fuller**  
Aug 22, 2024 5:02 PM

## #356 [UNIT 172] Filters to be changed.

**Status**

Open

**Start Date**

Aug 20, 2024

**Type**

Planned Work

**Created**

Aug 22, 2024 3:51 PM  
ianf@nationaltab.com

**Description**

Filters are dirty in AC#1.They need to be changed with extra set provided per specification.

**Last Updated**

Aug 22, 2024 5:02 PM

### Photos



IMG\_8140

Ian Fuller

Aug 22, 2024 5:02 PM

## #355 [UNIT 173] (MISC) AC#5 alarm

<b>Status</b> Open	<b>Start Date</b> Aug 20, 2024
<b>Type</b> Planned Work	<b>Created</b> Aug 22, 2024 3:51 PM ianf@nationaltab.com
<b>Description</b> Alarm 12 Comp 1 High Pressure.	<b>Last Updated</b> Aug 22, 2024 5:03 PM

### Photos



IMG\_8156

Ian Fuller

Aug 22, 2024 5:03 PM