

Report By:

**National TAB
1329 E. KEMPER ROAD
SUITE 4210
CINCINNATI, OH 45246**



**Report: test
Function: Test, Adjust, & Balance
Date: 11/09/2022**

**PROJECT
09-12 FIVE GUYS #0420 - HIGHLANDS
RANCH, CO (RENEW)**

**9352 S. COLORADO BLVD
HIGHLANDS RANCH, CO 80126**

Client

**Five Guys Enterprises LLC
20718 Richmond Highway
Lorton, VA 22079**

National TAB

Project: 09-12 FIVE GUYS #0420 - HIGHLANDS RANCH, CO (RENEW)

Table Of Contents

Section	Page #
Checklist Data	3



Comfort. Under control.

09-12 FIVE GUYS #0420 - HIGHLANDS RANCH, CO (RENEW)

CheckList Information

Name : 5 GUYS HVAC PERFORMANCE EVALUATION

Status : NotSubmitted

Assigned Organization : National TAB

Asset :

Requesting Organization : National TAB


CheckList Item Details

STORE FRONT PICTURE



Screenshot_20221026_1...

ROOFTOP PICTURES (ADD THREE FROM DIFFERENT ANGLES)

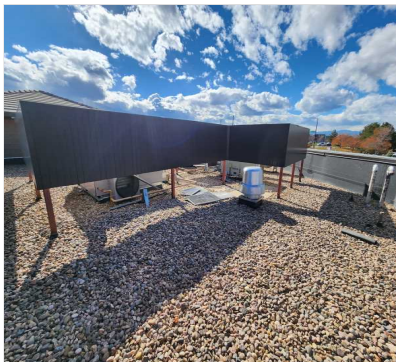

20221026_135138.jpg



20221026_135125.jpg



20221026_135108.jpg

RTU1 (TAKE PICTURE OF UNIT)**20221026_135313.jpg**

MFG & MODEL NUMBER

CARRIER 48TMF016

OA CFM

345 CFM

OA DAMPER POSITION

15% OPEN

**20221026_135727.jpg**

FAN SUCTION AND DISCHARGE PRESSURE

-0.22" FAN SUCTION 0.15" FAN DISCHARGE

BLOWER MOTOR RLA / FLA

7.1/7.2/7.1 FLA 15.8 5 HP

RTU2 (TAKE PICTURE OF UNIT)



20221026_135317.jpg

MFG & MODEL NUMBER	TRANE YSC060A3EMA0WA10
OA CFM	660 CFM
OA DAMPER POSITION	E(100% OPEN)



20221026_140142.jpg


FAN SUCTION AND DISHCHARGE PRESSURE	-0.52" FAN SUCTION 0.11"
BLOWER MOTOR RLA / FLA	5.6/5.8/1.2 FLA 6.2 1HP
RTU3 (TAKE PICTURE OF UNIT)	



20221026_135327.jpg

MFG & MODEL NUMBER

TRANE YSC060A3RHA0L NOT FUNCTIONAL

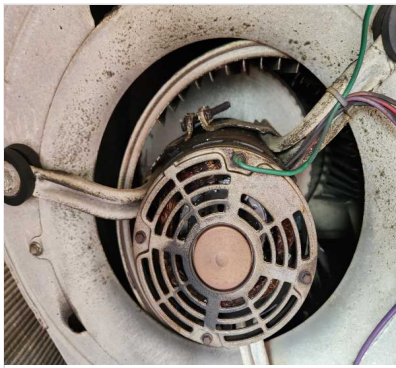

20221026_154835.jpg

OA CFM

0

OA DAMPER POSITION

E (100% OPEN)

FAN SUCTION AND DISCHARGE PRESSURE

0

BLOWER MOTOR RLA / FLA

0 FLA 6.2 0.9HP

KEF1 - HOOD 1 (TAKE PICTURE OF UNIT)



20221026_135333.jpg

MFG & MODEL NUMBER	COOK 165VCRH
EXH-CFM	836 CFM
MOTOR RLA / FLA	NA FLA 11/5.5
KEF2 - HOOD 2 (TAKE PICTURE OF UNIT)	



20221026_135334.jpg

MFG & MODEL NUMBER	MARSHALL AIR SYSTEMS G1530
EXH-CFM	1419 CFM
MOTOR RLA / FLA	NA FLA 8.4/7.8
MUA - ALL HOODS (TAKE PICTURE OF UNIT)	



20221026_135349.jpg

MFG & MODEL NUMBER	ABSOLUTE AIR V1-HOM
MUA-CFM	365 CFM
MOTOR RLA/FLA	1.4/1.6/1.3 FLA 3.4

KITCHEN HOODS (TAKE PICTURE OF HOODS)



20221026_162503.jpg

CONTROLS AND PERFORMANCE

TAKE PICTURE OF THERMOSTATS AND WALL SENSORS



20221026_162611.jpg



20221026_162545.jpg

ARE THERMOSTATS PROGRAMMED FOR OCCUPIED HOURS
AND IS THE FAN IN "ON" MODE DURING OCCUPIED TIMES

YES

BUILDING PRESSURE (FINAL)

-0.0189"

HOOD CAPTURE (WITNESS COOKING OR SMOKE TEST)

KEF-1 50% CAPTURE KEF-2 100% CAPTURE JOSEPH

ANY COMMENTS:

Notes/Comments :