



Comfort. Under control.

08-22 SWEETGREEN #MN178 EDINA, MN (TAB, IAQ)

Project Issue Information

Issue Name : RTU-1 (Kitchen) final filters very dirty.

Description : Very dirty filters, removed for balance.

Created By : National TAB

Assigned To : National TAB - Will Turnbough

Status : Open

Originated Date : 08/24/2022 - Michael McDonnell - National TAB

Project Issue File Details



FuseIT357bfd130b3646968bbb7
e130385418a.jpeg



Comfort. Under control.

08-22 SWEETGREEN #MN178 EDINA, MN (TAB, IAQ)

Project Issue Information

Issue Name : RTU-1 diffuser 1-3 low on airflow.

Description : Diffuser 1-3 is at 294/400cfm (74%). Take off for diffuser comes off top of supply duct. Damper is not accessible due to hard ceiling. RTU is at FLA and speed cannot be increased, cannot push more air to this diffuser.

Created By : National TAB

Assigned To : National TAB - Will Turnbough

Status : Open

Originated Date : 08/25/2022 - Michael McDonnell - National TAB

Project Issue File Details



9a470c6d_0c44_4a30_816d_2ec
4a19b3946.jpg



26984fcf_37ee_48d6_a649_68ee
3890dbfc.jpg



Comfort. Under control.

08-22 SWEETGREEN #MN178 EDINA, MN (TAB, IAQ)

Project Issue Information

Issue Name : RTU-1 ECONOMIZER NOT FUNCTIONAL

Description : Economizer bypassed in unit. Set OA manually with screw.

Created By : National TAB

Assigned To : National TAB - Michael McDonnell

Status : Open

Originated Date : 08/25/2022 - Michael McDonnell - National TAB

Project Issue File Details



eeb6f8d3_6400_4b7b_a29f_39a
8b37d40fa.jpg



d1a62b06_bf53_4bbc_903e_24b
02128e66e.jpg



Comfort. Under control.

08-22 SWEETGREEN #MN178 EDINA, MN (TAB, IAQ)

Project Issue Information

Issue Name : RTU-1 PKG (air purifier installation)

Description : PKG installed underneath belt-drive. Recommend relocating to mimic RTU-2 placement atop blower housing. Exposed wiring not covered. Recommend covering to prevent long term damage to wiring.

Created By : National TAB

Assigned To : National TAB - Michael McDonnell

Status : Open

Originated Date : 08/26/2022 - Michael McDonnell - National TAB



Comfort. Under control.

08-22 SWEETGREEN #MN178 EDINA, MN (TAB, IAQ)

Project Issue Information

Issue Name : RTU-2 (Dining) Dirty construction filters installed.
Description : Dirty construction filters still installed in RTU. Removed for balance.
Created By : National TAB **Assigned To :** National TAB - Will Turnbough
Status : Open
Originated Date : 08/24/2022 - Michael McDonnell - National TAB

Project Issue File Details



FuselT56e5d39565194543b632e
17a225a60ce.jpeg



Comfort. Under control.

08-22 SWEETGREEN #MN178 EDINA, MN (TAB, IAQ)

Project Issue Information

Issue Name : RTU-2 PKG (air purifier installation)

Description : Exposed wiring not covered. Recommend exposed wiring is covered with split loom to prevent long term damage to wiring.


Created By : National TAB

Assigned To : National TAB - Michael McDonnell

Status : Open

Originated Date : 08/26/2022 - Michael McDonnell - National TAB

Project Issue File Details

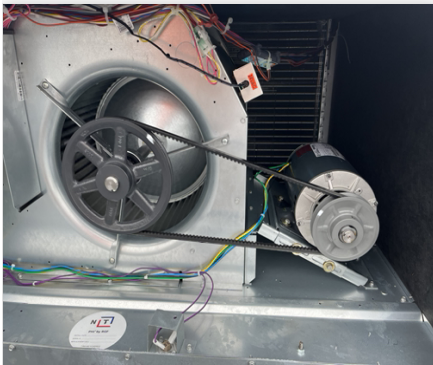

FuselT827727fedd3f4693bb76fe
0300676d2c.jpeg